


# Asbestos Register

(Hazardous Materials and Risk Assessment)



**School :** Warrawong Public School (3104)  
**Region :** Illawarra and South East  
**State Electorate :** Wollongong  
**Local Government Area :** Wollongong

**Initial Survey :** Noel Arnold & Associates : 14 - Apr - 2008  
**Reviewed By :** Greencap-NAA : 02 - Aug - 2016

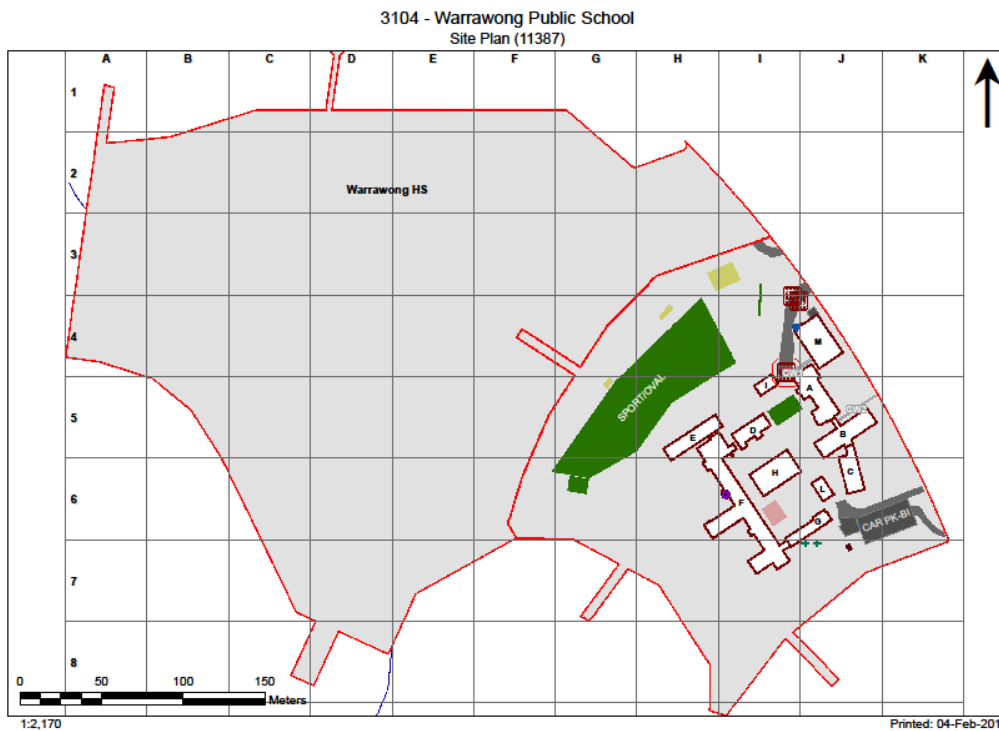

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Staff Facilities - 1946 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
In-fill-panel	Flat AC Sheeting	3m2	North east	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00E/In-fill-panel/S11					<b>Chrysotile (white asbestos)</b>	

**Interior**

**B00A - R0001 - Staff Room (33.14 m2)**

No Asbestos

**B00A - R0002 - Main Switch Board (0.59 m2)**

Electrical Mounting Board	Resinous Board	2Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						

**B00A - R0003 - Distribution Board (1.17 m2)** Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	2Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						

**B00A - R0004 - Main Switch Board (1.26 m2)**

No Asbestos

**B00A - R0005 - Movement (8.24 m2)**

No Asbestos

**B00A - R0006 - Movement (1.44 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00I/R0001/Ceiling Structures/Linings/S16				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R0007 - Staff Toilet (4.75 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00A/R0007/Floor Coverings Res/Textile/S17					<b>Chrysotile (white asbestos)</b>	

**B00A - R0008 - Movement (3.07 m2)**

No Asbestos

**B00A - R0009 - General Storeroom (6.53 m2)**

No Asbestos

**B00A - R0010 - Movement (3.29 m2)**

No Asbestos

**B00A - R0011 - Security Store (9.19 m2)**

No Asbestos

**B00A - R0012 - Staff Toilet (4.32 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00A/R0007/Floor Coverings Res/Textile/S17					<b>Chrysotile (white asbestos)</b>	

**B00A - R0013 - Movement (7.7 m2)**

No Asbestos

**B00A - R0014 - General Storeroom (5 m2)**

No Asbestos

**B00A - R0015 - Movement (2.35 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R0016 - Sports Store (11.93 m2)</b>						
No Asbestos						
<b>B00A - R0017 - General Storeroom (4.38 m2)</b>						
No Asbestos						
<b>B00A - R0018 - Other-Vacant (6.89 m2)</b>						
No Asbestos						
<b>B00A - R0019 - Cleaning Distributed Store (5.67 m2)</b>						
No Asbestos						
<b>B00A - R0020 - Movement (1.87 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B001/R0001/Ceiling Structures/Linings/S16				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00A - R0021 - Home Base - M (59.52 m2)</b>						
No Asbestos						
<b>B00A - R0022 - Home Base (51.04 m2)</b>						
No Asbestos						
<b>B00A - R0023 - Home Base (50.98 m2)</b>						
No Asbestos						
<b>B00A - R0024 - General Storeroom (0.99 m2)</b>						
No Asbestos						
<b>B00A - R0025 - General Storeroom (2.74 m2)</b>						
No Asbestos						
<b>B00A - R0026 - Movement (74.52 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Infront of R0012	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00A/R0007/Floor Coverings Res/Textile/S17				<b>Chrysotile (white asbestos)</b>		
<b>B00A - R0027 - Movement (16.69 m2)</b>						
In-fill-panel	Flat AC Sheeting	3m	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00E/In-fill-panel/S13				<b>Chrysotile (white asbestos)</b>		
<b>B00A - R1001 - Home Base (51.75 m2)</b>						
No Asbestos						
<b>B00A - R1002 - Movement (3.04 m2)</b>						
No Asbestos						
<b>B00A - R1003 - Staff Room Annexe (17.9 m2)</b>						
No Asbestos						
<b>B00A - R1004 - General Storeroom (9.75 m2)</b>						
No Asbestos						
<b>B00A - R1005 - Movement (8.43 m2)</b>						
No Asbestos						
<b>B00A - R1006 - Home Base (60.68 m2)</b>						
No Asbestos						
<b>B00A - R1007 - Home Base Store (5.4 m2)</b>						
No Asbestos						
<b>B00A - R1008 - Home Base Store (6.78 m2)</b>						
No Asbestos						
<b>B00A - R1009 - Home Base (51.25 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - R1010 - Home Base (51.65 m2)**

No Asbestos

**B00A - R1011 - Movement (59.38 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning/Administration - 1950 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
In-fill-panel	Flat AC Sheeting	20m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00E/In-fill-panel/S11					<b>Chrysotile (white asbestos)</b>	

**Interior****B00B - R0001 - Home Base (58.99 m2)**

No Asbestos

**B00B - R0002 - Home Base Store (4.43 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00A/R0007/Floor Coverings Res/Textile/S17					<b>Chrysotile (white asbestos)</b>	

**B00B - R0003 - Movement (19.46 m2)**

No Asbestos

**B00B - R0004 - Home Base (59.49 m2)**

No Asbestos

**B00B - R0005 - Home Base Store (4.43 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00A/R0007/Floor Coverings Res/Textile/S17					<b>Chrysotile (white asbestos)</b>	

**B00B - R0006 - Practical Activities - 1hb (12.32 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00A/R0007/Floor Coverings Res/Textile/S17					<b>Chrysotile (white asbestos)</b>	

**B00B - R0007 - General Storeroom (3.78 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00A/R0007/Floor Coverings Res/Textile/S17					<b>Chrysotile (white asbestos)</b>	

**B00B - R0008 - General Storeroom (9.4 m2)**

No Asbestos

**B00B - R0009 - Duplicating Workroom (31.41 m2)**

No Asbestos

**B00B - R0010 - Interview (23.51 m2)**

No Asbestos

**B00B - R0011 - Staff Room Annexe (4.68 m2)**

No Asbestos

**B00B - R0012 - General Storeroom (4.5 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00A/R0007/Floor Coverings Res/Textile/S17					<b>Chrysotile (white asbestos)</b>	

**B00B - R0013 - Staff Toilet (5.27 m2)**

No Asbestos

**B00B - R0014 - Principal (19.58 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0015 - General Storeroom (6.41 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00A/R0007/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
<b>B00B - R0016 - Clerical Office (15.06 m2)</b>						
No Asbestos						
<b>B00B - R0017 - Entry Vestibule (15.95 m2)</b>						
No Asbestos						
<b>B00B - R0018 - Movement (82.34 m2)</b>						
In-fill-panel	Flat AC Sheeting	25m	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00B/R0018/In-fill-panel/S18					Chrysotile (white asbestos)	
<b>B00B - R0019 - Movement (12.82 m2)</b>						
No Asbestos						
<b>B00B - R0020 - Movement (11.08 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00B/R0020/Ceiling Structures/Linings/S29					Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00B - R9001 - Garden Store (11.69 m2)</b>						
No Asbestos						
<b>B00B - R9002 - General Storeroom (15.23 m2)</b>						
No Asbestos						
<b>B00B - R9003 - Cleaning Supplies (10.5 m2)</b>						
No Asbestos						
<b>B00B - R9004 - Practical Activities - 1hb (16.86 m2)</b>						
No Asbestos						
<b>B00B - R9005 - General Storeroom (11.48 m2)</b>						
No Asbestos						
<b>B00B - R9006 - General Storeroom (10.67 m2)</b>						
No Asbestos						
<b>B00B - R9007 - General Storeroom (13.45 m2)</b>						
No Asbestos						
<b>B00B - R9008 - General Storeroom (80.54 m2)</b>						
No Asbestos						
<b>B00B - R9009 - General Storeroom (5.13 m2)</b>						
No Asbestos						
<b>B00B - R9010 - Staff Shower/Change (5.13 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1965 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height Restriction</b>						
In-fill-panel	Flat AC Sheeting	50m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00E/In-fill-panel/S11					<b>Chrysotile (white asbestos)</b>

**Interior****B00C - R0001 - General Storeroom (18.83 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	3104/B00C/R0007/Ceiling Structures/Linings/S19					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00C/R0008/Floor Coverings Res/Textile/S20					<b>Chrysotile (white asbestos)</b>
Wall Linings Internal	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00C/R0001/Wall Linings Internal/S21					<b>Chrysotile (white asbestos)</b>

**B00C - R0002 - Home Base (58.06 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	3104/B00C/R0007/Ceiling Structures/Linings/S19					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0003 - Home Base Store (4.38 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	3104/B00C/R0007/Ceiling Structures/Linings/S19					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00C/R0008/Floor Coverings Res/Textile/S20					<b>Chrysotile (white asbestos)</b>

**B00C - R0004 - Personal Effects Storage (13.84 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	3104/B00C/R0007/Ceiling Structures/Linings/S19					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0005 - Distribution Board (0.42 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	3104/B00C/R0007/Ceiling Structures/Linings/S19					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0006 - Movement (4.53 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	3104/B00C/R0007/Ceiling Structures/Linings/S19					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0007 - Home Base (57.52 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	3104/B00C/R0007/Ceiling Structures/Linings/S19					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0008 - Home Base Store (4.35 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite					
	3104/B00C/R0007/Ceiling Structures/Linings/S19					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00C/R0008/Floor Coverings Res/Textile/S20					Chrysotile (white asbestos)

**B00C - R0009 - General Storeroom (8.13 m2)**

No Asbestos

**B00C - R0010 - Movement (50.9 m2)**

Ceiling Structures/Linings	Vermiculite					
	3104/B00C/R0007/Ceiling Structures/Linings/S19					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00C - R0011 - Movement (13.65 m2)**

No Asbestos

**B00C - R1001 - Home Base (58.79 m2)**

No Asbestos

**B00C - R1002 - Home Base Store (4.28 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	3104/B00C/R1009/Floor Coverings Res/Textile/S22					No Asbestos Detected

**B00C - R1003 - Personal Effects Storage (13.77 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	3104/B00C/R1009/Floor Coverings Res/Textile/S22					No Asbestos Detected

**B00C - R1004 - Distribution Board (0.49 m2)** Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00C/R0001/Wall Linings Internal/S21					Chrysotile (white asbestos)

**B00C - R1005 - Movement (4.47 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	3104/B00C/R1009/Floor Coverings Res/Textile/S22					No Asbestos Detected

**B00C - R1006 - Home Base (57.61 m2)**

No Asbestos

**B00C - R1007 - Home Base Store (4.28 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	3104/B00C/R1009/Floor Coverings Res/Textile/S22					No Asbestos Detected

**B00C - R1008 - Uniform Shop (10.8 m2)**

No Asbestos

**B00C - R1009 - Movement (65.73 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	3104/B00C/R1009/Floor Coverings Res/Textile/S22					No Asbestos Detected





Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1950 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00D/Gable Verge Lining/S24					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Eaves Linings	Flat AC Sheeting	80m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Height Restriction</b>					

**Interior****B00D - R0001 - Home Base (58.65 m2)**

No Asbestos

**B00D - R0002 - Home Base Store (5.02 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00E/R0015/Floor Coverings Res/Textile/S14					<b>Chrysotile (white asbestos)</b>

**B00D - R0003 - Personal Effects Storage (5.34 m2)**

No Asbestos

**B00D - R0004 - Personal Effects Storage (5.16 m2)**

No Asbestos

**B00D - R0005 - Movement (6.48 m2)**

No Asbestos

**B00D - R0006 - Movement (9.26 m2)**

No Asbestos

**B00D - R0007 - Home Base (58.9 m2)**

No Asbestos

**B00D - R0008 - Home Base Store (5.25 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00E/R0015/Floor Coverings Res/Textile/S14					<b>Chrysotile (white asbestos)</b>

**B00D - R0009 - Interview (21.82 m2)**

No Asbestos

**B00D - R0010 - Movement (6.5 m2)**

No Asbestos

**B00D - R0011 - Movement (9.26 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1965 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00E/Gable Verge Lining/S25					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00E/Eaves Linings/S30					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
In-fill-panel	Flat AC Sheeting	7m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00E/In-fill-panel/S11					<b>Chrysotile (white asbestos)</b>
In-fill-panel	Flat AC Sheeting	50m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00E/In-fill-panel/S13					<b>Chrysotile (white asbestos)</b>

**Interior**

**B00E - R0001 - Home Base (59.34 m2)**

No Asbestos

**B00E - R0002 - Home Base Store (4.42 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00E/R0015/Floor Coverings Res/Textile/S14					<b>Chrysotile (white asbestos)</b>

**B00E - R0003 - Personal Effects Storage (5.84 m2)**

No Asbestos

**B00E - R0004 - Personal Effects Storage (5.36 m2)**

No Asbestos

**B00E - R0005 - Movement (7.06 m2)**

No Asbestos

**B00E - R0006 - Distribution Board (0.49 m2)**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3104/B00E/R0006/Wall Linings Internal/S15					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00E - R0007 - Home Base (59.18 m2)**

No Asbestos

**B00E - R0008 - Home Base Store (4.42 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00E/R0015/Floor Coverings Res/Textile/S14					<b>Chrysotile (white asbestos)</b>

**B00E - R0009 - Home Base (59.19 m2)**

No Asbestos

**B00E - R0010 - Home Base Store (4.35 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00E/R0015/Floor Coverings Res/Textile/S14					<b>Chrysotile (white asbestos)</b>

**B00E - R0011 - Personal Effects Storage (5.9 m2)**

No Asbestos

**B00E - R0012 - Personal Effects Storage (5.84 m2)**

No Asbestos

**B00E - R0013 - Movement (7.05 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00E - R0014 - Home Base (59.35 m2)**

No Asbestos

**B00E - R0015 - Home Base Store (4.3 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00E/R0015/Floor Coverings Res/Textile/S14					<b>Chrysotile (white asbestos)</b>	

**B00E - R9001 - General Storeroom (88.42 m2)**

No Asbestos

**B00E - R9002 - General Storeroom (210.48 m2)**

Pillar packing	Flat AC Sheeting	5m2	Variable positions	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
3104/B00E/R9002/Pillar packing/S12					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning/Staff Facilities - 1957 - Concrete (Concrete)****Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 3104/B00F/Eaves Linings/S31	100m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting 3104/B00F/Gable Verge Lining/S26	80m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Ends	Flat AC Sheeting 3104/B00F/Gable Ends/S27	30m2	Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior****B00F - R0001 - Home Base (68.16 m2)**

No Asbestos

**B00F - R0002 - Movement (6.02 m2)**

No Asbestos

**B00F - R0003 - Personal Effects Storage (9.43 m2)**

No Asbestos

**B00F - R0004 - Personal Effects Storage (9.43 m2)**

No Asbestos

**B00F - R0005 - Movement (5.95 m2)**

No Asbestos

**B00F - R0006 - Movement (19.32 m2)**

No Asbestos

**B00F - R0007 - Home Base (65.99 m2)**

No Asbestos

**B00F - R0008 - Home Base (65.9 m2)**

No Asbestos

**B00F - R0009 - Movement (10.74 m2)**

No Asbestos

**B00F - R0010 - Movement (2.19 m2)**

No Asbestos

**B00F - R0011 - Personal Effects Storage (9.37 m2)**

No Asbestos

**B00F - R0012 - Personal Effects Storage (9.37 m2)**

No Asbestos

**B00F - R0013 - Movement (6.05 m2)**

No Asbestos

**B00F - R0014 - Home Base (65.99 m2)**

No Asbestos

**B00F - R0015 - Duplicating Workroom (22.34 m2)**

No Asbestos

**B00F - R0016 - Staff Kitchen (2.69 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R0017 - Movement (27.94 m2)</b>						
No Asbestos						
<b>B00F - R0018 - Staff Toilet (3.82 m2)</b>						
No Asbestos						
<b>B00F - R0019 - General Storeroom (2.14 m2)</b>						
No Asbestos						
<b>B00F - R0020 - Movement (2.35 m2)</b>						
No Asbestos						
<b>B00F - R0021 - Sick Bay (17.18 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00F/R0021/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R0022 - General Storeroom (3.92 m2)</b>						
No Asbestos						
<b>B00F - R0023 - General Storeroom (3.33 m2)</b>						
No Asbestos						
<b>B00F - R0024 - Cleaning Distributed Store (6.13 m2)</b>						
No Asbestos						
<b>B00F - R0025 - Movement (26.84 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00F/R0025/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00F - R0026 - Movement (3.69 m2)</b>						
In-fill-panel	Flat AC Sheeting	2m	Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00F/R0027/In-fill-panel/S4					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R0027 - Movement (3.69 m2)</b>						
In-fill-panel	Flat AC Sheeting	2m	Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00F/R0027/In-fill-panel/S4					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R0028 - Communal Space (135.39 m2)</b>						
No Asbestos						
<b>B00F - R0029 - Raised Platform (25.37 m2)</b>						
No Asbestos						
<b>B00F - R0030 - General Storeroom (4.65 m2)</b>						
No Asbestos						
<b>B00F - R0031 - Home Base (66.35 m2)</b>						
No Asbestos						
<b>B00F - R0032 - Movement (10.79 m2)</b>						
No Asbestos						
<b>B00F - R0033 - Movement (2.02 m2)</b>						
No Asbestos						
<b>B00F - R0034 - General Storeroom (9.44 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00F/R0034/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R0035 - Personal Effects Storage (9.5 m2)</b>						
No Asbestos						
<b>B00F - R0036 - Movement (6.09 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00F - R0037 - Home Base (59.86 m2)</b>						
In-fill-panel	Flat AC Sheeting	5m	West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00F/R0037/In-fill-panel/S6					Chrysotile (white asbestos)	
<b>B00F - R0038 - Withdrawal Space - 1hb (3.79 m2)</b>						
No Asbestos						
<b>B00F - R0039 - Home Base (91.35 m2)</b>						
In-fill-panel	Flat AC Sheeting	10m	North, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00F/R0037/In-fill-panel/S6					Chrysotile (white asbestos)	
<b>B00F - R0040 - Withdrawal Space - 1hb (4.43 m2)</b>						
No Asbestos						
<b>B00F - R0041 - Withdrawal Space - 1hb (4.16 m2)</b>						
No Asbestos						
<b>B00F - R0042 - Home Base (93.86 m2)</b>						
In-fill-panel	Flat AC Sheeting	10m	North, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00F/R0037/In-fill-panel/S6					Chrysotile (white asbestos)	
<b>B00F - R0043 - Withdrawal Space - 1hb (5.91 m2)</b>						
No Asbestos						
<b>B00F - R0044 - Practical Activities - 1hb (1.45 m2)</b>						
No Asbestos						
<b>B00F - R0045 - Home Base Store (6.9 m2)</b>						
In-fill-panel	Flat AC Sheeting	2m	Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00F/R0037/In-fill-panel/S6					Chrysotile (white asbestos)	
<b>B00F - R0046 - Movement (2.23 m2)</b>						
In-fill-panel	Flat AC Sheeting	3m	Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00F/R0037/In-fill-panel/S6					Chrysotile (white asbestos)	
<b>B00F - R0047 - Personal Effects Storage (12.8 m2)</b>						
No Asbestos						
<b>B00F - R0048 - Personal Effects Storage (12.8 m2)</b>						
No Asbestos						
<b>B00F - R0049 - Movement (2.92 m2)</b>						
No Asbestos						
<b>B00F - R0050 - Toilets - Boys/Girls (11.1 m2)</b>						
No Asbestos						
<b>B00F - R0051 - Staff Toilet (1.67 m2)</b>						
No Asbestos						
<b>B00F - R0052 - Movement (76.69 m2)</b>						
No Asbestos						
<b>B00F - R0053 - Movement (19.03 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00F/R0025/Ceiling Structures/Linings/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00F - R0054 - Movement (2.63 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00F/R0025/Ceiling Structures/Linings/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)		

**B00F - R0055 - Movement (4.97 m2)**

No Asbestos

**B00F - R0056 - Personal Effects Storage (6.99 m2)**

No Asbestos

**B00F - R0057 - Home Base (67.96 m2)**

No Asbestos

**B00F - R0058 - Home Base Store (4.44 m2)**

No Asbestos

**B00F - R0059 - Stairs (4.58 m2)**

No Asbestos

**B00F - R9001 - General Storeroom (28.55 m2)**

No Asbestos

**B00F - R9002 - Stairs (4.16 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Pupil Facilities - 1957 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00G/Gable Verge Lining/S28					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Eaves Linings	Flat AC Sheeting	80m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00G/Eaves Linings/S32					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior**

**B00G - R0001 - Movement (3.31 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00G/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00G - R0002 - Staff Toilet (1.65 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00G/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00G - R0003 - Canteen (31.99 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00G/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00G - R0004 - Canteen Office/Store (2.2 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00G/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00G - R0005 - Movement (26.41 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00G/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

Wall Linings Internal	Flat AC Sheeting	8m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00G/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00G - R0006 - General Assistant/Bulk Store (22.33 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00G/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00G - R0007 - General Storeroom (54.6 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00G/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00G - R0008 - Drinking Facilities (44.65 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B00G/R0008/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Library - 1980 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00H - R0001 - Distribution Board (1.76 m2)** Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00H/R0001/Wall Linings Internal/S8					<b>Chrysotile (white asbestos)</b>	

**B00H - R0002 - Library Office/Workroom (24.5 m2)**

Floor Coverings Res/Textile	Vinyl Tiles				
3104/B00H/R0002/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>

**B00H - R0003 - Security Store (12.97 m2)**

No Asbestos

**B00H - R0004 - Reading Area (224.07 m2)**

No Asbestos

**B00H - R0005 - Movement (131.79 m2)**

No Asbestos

**B00H - R0006 - Staff Toilet (2.64 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00H/R0006/Partition Walls (Cubicles)/S10					<b>Chrysotile (white asbestos)</b>	

**B00H - R0007 - Staff Toilet (2.64 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00H/R0006/Partition Walls (Cubicles)/S10					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Pupil Facilities - 1950 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B001/Gable Verge Lining/S23					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior**

**B001 - R0001 - Toilets - Boys (63.72 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B001/R0001/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B001 - R0002 - Staff Toilet (2.53 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3104/B001/R0001/Ceiling Structures/Linings/S16					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B001 - R0003 - Movement (10.07 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Pupil Facilities - 1957 - Concrete (Concrete)****Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior****B00L - R0001 - Toilets - Boys (45.59 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00L/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00L - R0002 - Staff Toilet (1.25 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00L/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00L - R0003 - Toilets - Girls (43.94 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00L/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00L - R0004 - Cleaning Distributed Store (2.89 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00L/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00L - R0005 - Staff Toilet (1.35 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3104/B00L/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00M - R0001 - Communal Space (145.77 m2)**

No Asbestos

**B00M - R0002 - Covered Outdoor Learning Area (150.52 m2)**

No Asbestos

**B00M - R0003 - Main Switch Board (3.37 m2)**

No Asbestos

**B00M - R0004 - Access Shower/Toilet (6.89 m2)**

No Asbestos

**B00M - R0005 - Cleaning Distributed Store (3.47 m2)**

No Asbestos

**B00M - R0006 - Plant (1.64 m2)**

No Asbestos

**B00M - R0007 - Toilet - Lobby (3.33 m2)**

No Asbestos

**B00M - R0008 - Toilets - Boys (5.58 m2)**

No Asbestos

**B00M - R0009 - Sound Cupboard (2.07 m2)**

No Asbestos

**B00M - R0010 - Toilets - Girls (7.14 m2)**

No Asbestos

**B00M - R0011 - Toilet - Lobby (2.46 m2)**

No Asbestos

**B00M - R0012 - P.E. Store (13 m2)**

No Asbestos

**B00M - R0013 - Communal/Performance Store (9.55 m2)**

No Asbestos

**B00M - R0014 - Hall Chair Store (9.48 m2)**

No Asbestos

**B00M - R0015 - External Movement (1.77 m2)**

No Asbestos

**B00M - R0016 - Movement (12.52 m2)**

No Asbestos

**B00M - R0017 - Movement (11.19 m2)**

No Asbestos

**B00M - R0018 - Raised Platform (61.76 m2)**

No Asbestos

**B00M - R0019 - Movement (6.27 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017