


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Warwick Farm Public School (3678)
Region : South Western Sydney
State Electorate : Liverpool
Local Government Area : Liverpool

Initial Survey : Noel Arnold & Associates : 21 - May - 2008
Reviewed By : Parsons Brinckerhoff : 11 - Sep - 2015

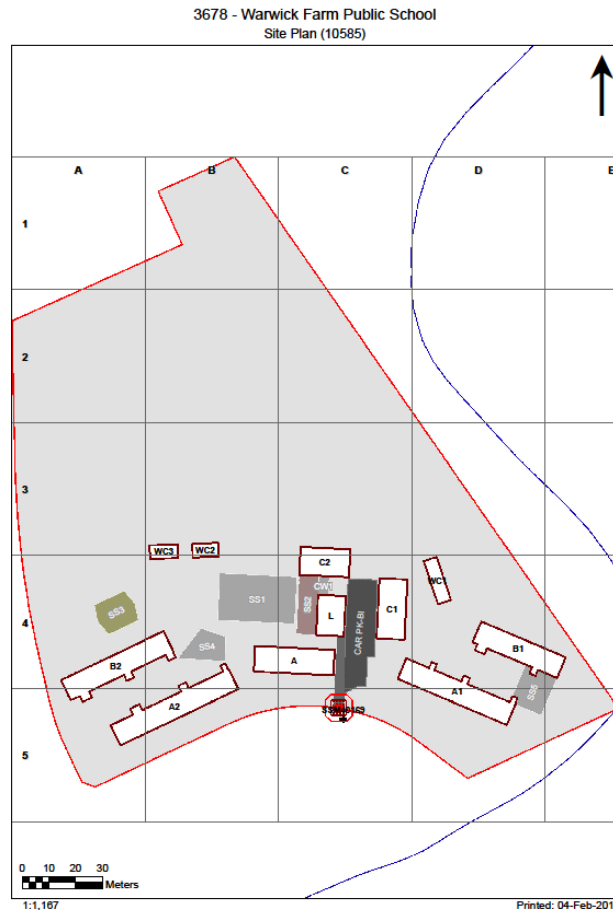

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Pupil Facilities - 1950 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3678/B00A/Eaves Linings/S20					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	16m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3678/B00A/Gable Verge Lining/S21					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Duplicating Workroom

No Asbestos

B00A - R0003 - Movement

No Asbestos

B00A - R0005 - Principal

No Asbestos

B00A - R0006 - Staff Toilet

No Asbestos

B00A - R0007 - General Storeroom

No Asbestos

B00A - R0008 - Cleaning Distributed Store

No Asbestos

B00A - R0009 - Staff Room

No Asbestos

B00A - R0010 - Interview

No Asbestos

B00A - R0011 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3678/B00A/R0011/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00A - R0013 - General Storeroom

No Asbestos

B00A - R0015 - Deputy Principal

No Asbestos

B00A - R0016 - Sick Bay

No Asbestos

B00A - R0017 - General Storeroom

No Asbestos

B00A - R0018 - Main Switch Board

No Asbestos

B00A - R0019 - Garden Store

No Asbestos

B00A - R0020 - General Assistant/Bulk Store

No Asbestos

B00A - R0021 - Movement

No Asbestos

B00A - R0022 - Canteen

No Asbestos

B00A - R0023 - Staff Toilet

No Asbestos

B00A - R0024 - Canteen Office/Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0025 - Movement

No Asbestos

B00A - R0026 - Sick Bay

No Asbestos

B00A - R0027 - Toilet - Lobby

No Asbestos

B00A - R0028 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	
	3678/B00A/R0028/Wall Linings Internal/S22	No Asbestos Detected

B00A - R0029 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	
	3678/B00A/R0028/Wall Linings Internal/S22	No Asbestos Detected

B00A - R0030 - Toilet - Lobby

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 1950 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	18m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3678/B00L/Eaves Linings/S23				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	12m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3678/B00L/Gable Verge Lining/S42				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00L - R0001 - Movement

No Asbestos

B00L - R0002 - Withdrawal Space - 1hb

No Asbestos

B00L - R0003 - Home Base Store

No Asbestos

B00L - R0004 - Home Base

No Asbestos

B00L - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3678/B00L/R0005/Ceiling Structures/Linings/S11				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A1 - General Learning/Library - 1950 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 3678/B0A1/Eaves Linings/S25					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting 3678/B0A1/Gable Verge Lining/S26	12m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B0A1 - R0001 - Home Base**

Heater surround	Flat AC Sheeting 3678/B0A1/R0001/Heater surround/S12					No Asbestos Detected
-----------------	---	--	--	--	--	-----------------------------

B0A1 - R0004 - Craft Store

No Asbestos

B0A1 - R0005 - Interview

No Asbestos

B0A1 - R0006 - Movement

No Asbestos

B0A1 - R0007 - General Storeroom

No Asbestos

B0A1 - R0008 - General Storeroom

No Asbestos

B0A1 - R0009 - Movement

No Asbestos

B0A1 - R0010 - Library Office/Workroom

No Asbestos

B0A1 - R0011 - Communications Room

No Asbestos

B0A1 - R0012 - Reading Area

No Asbestos

B0A1 - R0013 - Movement

No Asbestos

B0A1 - R0014 - Toilets - Boys/Girls

No Asbestos

B0A1 - R0015 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3678/B0A1/R0015/Ceiling Structures/Linings/S13	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
In-fill-panel	Flat AC Sheeting 3678/B0A1/R0015/In-fill-panel/S14	1m	Above door	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B0A1 - R0016 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3678/B0A1/R0015/Ceiling Structures/Linings/S13	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
In-fill-panel	Flat AC Sheeting 3678/B0A1/R0015/In-fill-panel/S14	1m	Above door	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B0A1 - R0017 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3678/B0A1/R0015/Ceiling Structures/Linings/S13				Chrysotile (white asbestos) , Amosite (brown asbestos)		
In-fill-panel	Flat AC Sheeting	1m	Above door	Good Condition (1)	Low (1)	Low Priority (2-3)
3678/B0A1/R0015/In-fill-panel/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B0A1 - R0018 - Practical Activities

No Asbestos

B0A1 - R0019 - Home Base Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0A2 - General Learning - 1963 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 3678/B0A2/Eaves Linings/S27					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting 3678/B0A2/Gable Verge Lining/S28	16m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B0A2 - R0002 - Personal Effects Storage**

No Asbestos

B0A2 - R0003 - Home Base Store

No Asbestos

B0A2 - R0005 - Home Base

No Asbestos

B0A2 - R0009 - Home Base

No Asbestos

B0A2 - R0010 - Home Base

No Asbestos

B0A2 - R0013 - Movement

No Asbestos

B0A2 - R0014 - Cleaning Distributed Store

No Asbestos

B0A2 - R0015 - Movement

No Asbestos

B0A2 - R0016 - Interview

No Asbestos

B0A2 - R0019 - Home Base

No Asbestos

B0A2 - R0020 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3678/B0A2/R0020/Ceiling Structures/Linings/S1	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 3678/B0A2/R0020/In-fill-panel/S2	1m	Above door	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B0A2 - R0021 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3678/B0A2/R0020/Ceiling Structures/Linings/S1	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 3678/B0A2/R0020/In-fill-panel/S2	1m	Above door	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B0A2 - R0022 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3678/B0A2/R0020/Ceiling Structures/Linings/S1	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 3678/B0A2/R0020/In-fill-panel/S2	1m	Above door	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B0A2 - R0023 - Home Base Store

No Asbestos

B0A2 - R0024 - Home Base Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B0A2 - R0025 - Home Base Store

No Asbestos

B0A2 - R0026 - Practical Activities

No Asbestos

B0A2 - R0027 - Practical Activities

No Asbestos

B0A2 - R0028 - Home Base Store

No Asbestos

B0A2 - R0029 - Personal Effects Storage

No Asbestos

B0A2 - R0030 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0B1 - General Learning - 1950 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 3678/B0B1/Eaves Linings/S29					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting 3678/B0B1/Gable Verge Lining/S30	12m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B0B1 - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 3678/B0B1/R0001/Ceiling Structures/Linings/S15	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
In-fill-panel	Flat AC Sheeting 3678/B0B1/R0001/In-fill-panel/S16	1m	Above door	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B0B1 - R0002 - Movement

No Asbestos

B0B1 - R0003 - Movement

No Asbestos

B0B1 - R0004 - Practical Activities - 1hb

No Asbestos

B0B1 - R0005 - General Storeroom

No Asbestos

B0B1 - R0007 - Home Base

No Asbestos

B0B1 - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3678/B0B1/R0001/Ceiling Structures/Linings/S15	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
In-fill-panel	Flat AC Sheeting 3678/B0B1/R0001/In-fill-panel/S16	1m	Above door	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B0B1 - R0009 - Home Base

No Asbestos

B0B1 - R0013 - Home Base

No Asbestos

B0B1 - R0014 - Home Base Store

No Asbestos

B0B1 - R0015 - Home Base Store

No Asbestos

B0B1 - R0016 - Practical Activities

No Asbestos

B0B1 - R0017 - Home Base Store

No Asbestos

B0B1 - R0018 - Personal Effects Storage

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0B2 - General Learning - 1950 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 3678/B0B2/Eaves Linings/S31					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting 3678/B0B2/Gable Verge Lining/S32	12m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B0B2 - R0001 - Community Clinic**

No Asbestos

B0B2 - R0004 - Movement

No Asbestos

B0B2 - R0005 - General Storeroom

No Asbestos

B0B2 - R0007 - Home Base

Heater surround	Flat AC Sheeting 3678/B0B2/R0014/Heater surround/S6	1Unit(s)	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
-----------------	--	----------	------	--------------------	---------	---

B0B2 - R0009 - Home Base

Heater surround	Flat AC Sheeting 3678/B0B2/R0014/Heater surround/S6	1Unit(s)	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
-----------------	--	----------	------	--------------------	---------	---

B0B2 - R0013 - Home Base

Heater surround	Flat AC Sheeting 3678/B0B2/R0014/Heater surround/S6	1Unit(s)	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
-----------------	--	----------	------	--------------------	---------	---

B0B2 - R0014 - Home Base

Heater surround	Flat AC Sheeting 3678/B0B2/R0014/Heater surround/S6	1Unit(s)	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
-----------------	--	----------	------	--------------------	---------	---

B0B2 - R0017 - Movement

No Asbestos

B0B2 - R0018 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3678/B0B2/R0020/Ceiling Structures/Linings/S8	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 3678/B0B2/R0020/In-fill-panel/S7	1m	Above door	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B0B2 - R0019 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3678/B0B2/R0020/Ceiling Structures/Linings/S8	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In-fill-panel	Flat AC Sheeting 3678/B0B2/R0020/In-fill-panel/S7	7m	Above door	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B0B2 - R0020 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3678/B0B2/R0020/Ceiling Structures/Linings/S8	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
In-fill-panel	Flat AC Sheeting	1m	Above door	Good Condition (1)	Low (1)	Low Priority (2-3)
3678/B0B2/R0020/In-fill-panel/S7					Chrysotile (white asbestos)	

- B0B2 - R0022 - Practical Activities**
No Asbestos
- B0B2 - R0023 - Home Base Store**
No Asbestos
- B0B2 - R0024 - Home Base Store**
No Asbestos
- B0B2 - R0025 - Home Base Store**
No Asbestos
- B0B2 - R0026 - Practical Activities**
No Asbestos
- B0B2 - R0027 - Home Base Store**
No Asbestos
- B0B2 - R0028 - Home Base Store**
No Asbestos
- B0B2 - R0029 - Personal Effects Storage**
No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C1 - Communal Facilities - 1963 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 3678/B0C1/Eaves Linings/S33					No Asbestos Detected
Gable Verge Lining	Flat AC Sheeting 3678/B0C1/Gable Verge Lining/S34	24m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B0C1 - R0001 - Movement**

Wall Linings Internal	Flat AC Sheeting 3678/B0C1/R0001/Wall Linings Internal/S3	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	--	-----	-------	--------------------	---------	--

B0C1 - R0002 - Movement

No Asbestos

B0C1 - R0003 - Hall Chair Store

No Asbestos

B0C1 - R0004 - General Storeroom

No Asbestos

B0C1 - R0005 - Communal Space

No Asbestos

B0C1 - R0006 - Communal Space

No Asbestos

B0C1 - R0007 - Toilets - Boys/Girls

No Asbestos

B0C1 - R0008 - General Storeroom

No Asbestos

B0C1 - R0009 - Personal Effects Storage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0C2 - General Learning - 1950 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	18m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3678/B0C2/Eaves Linings/S35				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3678/B0C2/Gable Verge Lining/S36				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B0C2 - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3678/B0C2/R0001/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B0C2 - R0002 - Personal Effects Storage

No Asbestos

B0C2 - R0003 - Home Base

No Asbestos

B0C2 - R0004 - Home Base Store

No Asbestos

B0C2 - R0005 - Home Base

No Asbestos

B0C2 - R0006 - Home Base Store

No Asbestos

B0C2 - R0007 - Personal Effects Storage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

BWC1 - Pupil Facilities - 1950 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 3678/BWC1/Eaves Linings/S37					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**BWC1 - R0001 - Drinking Facilities**

No Asbestos

BWC1 - R0002 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet 3678/BWC1/R0002/Partition Walls (Cubicles)/S38					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

BWC1 - R0003 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet 3678/BWC1/R0002/Partition Walls (Cubicles)/S38					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

BWC1 - R0004 - Hall Chair Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

BWC2 - Pupil Facilities - 1950 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 3678/BWC2/Eaves Linings/S39					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**BWC2 - R0001 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet 3678/BWC2/R0001/Partition Walls (Cubicles)/S17					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

BWC2 - R0002 - Cleaning Distributed Store

No Asbestos

BWC2 - R0003 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

BWC3 - Pupil Facilities - 1950 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 3678/BWC3/Eaves Linings/S40					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**BWC3 - R0001 - Drinking Facilities**

No Asbestos

BWC3 - R0002 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet 3678/BWC3/R0002/Partition Walls (Cubicles)/S41					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

BWC3 - R0003 - Cleaning Distributed Store

Wall Linings Internal	Compressed AC Sheet 3678/B00A/R0028/Wall Linings Internal/S22					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3678_ASB_010313_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017