


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Woollooware Public School (3957)
Region : Sydney
State Electorate : Cronulla
Local Government Area : Sutherland

Initial Survey : Noel Arnold & Associates : 21 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

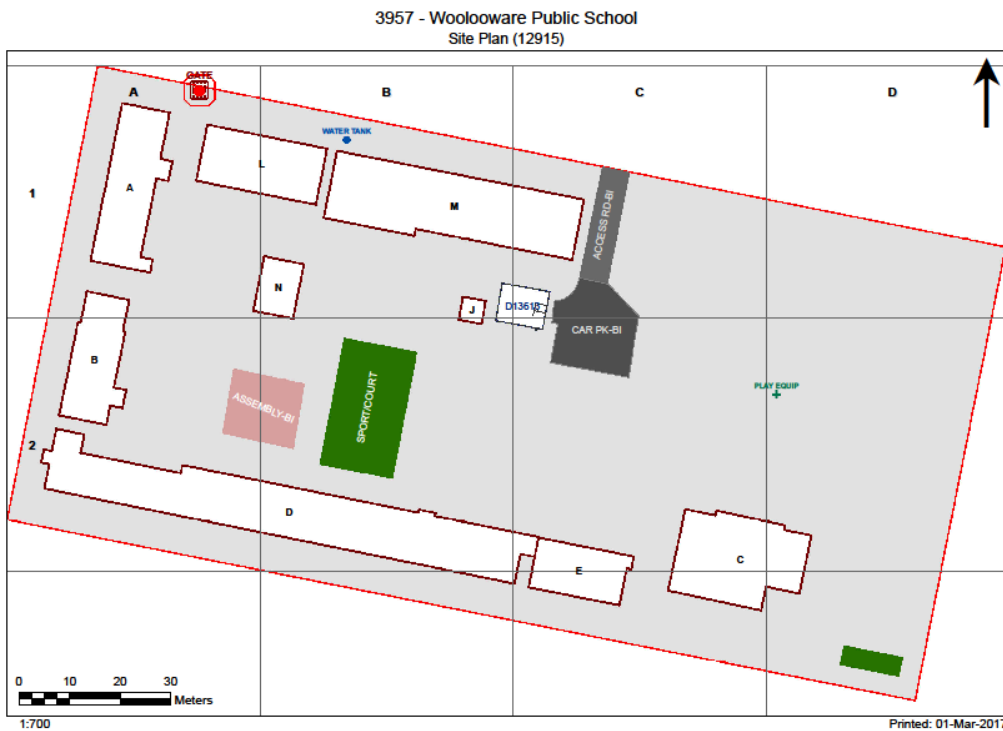

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning - 1963 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00B/R0005/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable verge lining	Flat AC Sheeting	20m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00A/Gable verge lining/S9			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00A - R0001 - Home Base

Wall Linings Internal	Flat AC Sheeting	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00A/R0012/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0002 - Practical Activities - 1hb

No Asbestos

B00A - R0003 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00B/R0005/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0004 - Movement

No Asbestos

B00A - R0005 - Personal Effects Storage

No Asbestos

B00A - R0006 - Cleaning Distributed Store

No Asbestos

B00A - R0007 - General Storeroom

No Asbestos

B00A - R0008 - Personal Effects Storage

No Asbestos

B00A - R0009 - Home Base

Wall Linings Internal	Flat AC Sheeting	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00A/R0012/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0010 - Practical Activities - 1hb

No Asbestos

B00A - R0011 - Toilets - Boys/Girls

No Asbestos

B00A - R0012 - Home Base

Wall Linings Internal	Flat AC Sheeting	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00A/R0012/Wall Linings Internal/S1			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0013 - Practical Activities - 1hb

No Asbestos

B00A - R0014 - Toilets - Boys/Girls

No Asbestos

B00A - R0015 - Personal Effects Storage

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0016 - Movement						
No Asbestos						
B00A - R0017 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3957/B00B/R0005/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1958 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00B/R0005/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceilling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00B - R0002 - Home Base

No Asbestos

B00B - R0003 - Staff Toilet

No Asbestos

B00B - R0004 - Movement

No Asbestos

B00B - R0005 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00B/R0005/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0006 - Deputy Principal

No Asbestos

B00B - R0007 - Staff Room

No Asbestos

B00B - R0008 - General Storeroom

No Asbestos

B00B - R0009 - Main Switch Board

No Asbestos

B00B - R0010 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Communal Facilities/Pupil Facilities - 1963 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00C - R0001 - Canteen

No Asbestos

B00C - R0002 - Canteen Office/Store

No Asbestos

B00C - R0003 - General Storeroom

No Asbestos

B00C - R0004 - Plant

No Asbestos

B00C - R0005 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0006 - Communal Space

No Asbestos

B00C - R0007 - External Movement

No Asbestos

B00C - R0008 - Movement

No Asbestos

B00C - R0009 - Toilets - Girls

No Asbestos

B00C - R0010 - Raised Platform

No Asbestos

B00C - R0011 - Toilets - Boys

No Asbestos

B00C - R0012 - Movement

No Asbestos

B00C - R0013 - Disabled Toilet

No Asbestos

B00C - R0014 - Cleaning Distributed Store

No Asbestos

B00C - R0015 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - General Learning - 1963 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00B/R0005/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable verge lining	Flat AC Sheeting	20m	East facing, West facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00D/Gable verge lining/S10			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00D - R0001 - Duplicating Workroom

No Asbestos

B00D - R0002 - General Storeroom

No Asbestos

B00D - R0006 - General Storeroom

No Asbestos

B00D - R0007 - Staff Toilet

No Asbestos

B00D - R0009 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00B/R0005/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0010 - Home Base

Wall Linings Internal	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00E/R0003/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0011 - Home Base Store

No Asbestos

B00D - R0012 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00B/R0005/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0013 - Cleaning Distributed Store

No Asbestos

B00D - R0014 - Movement

No Asbestos

B00D - R0015 - Personal Effects Storage

No Asbestos

B00D - R0016 - Home Base Store

No Asbestos

B00D - R0017 - Special Programs Room

Wall Linings Internal	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00E/R0003/Wall Linings Internal/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0018 - Movement

No Asbestos

B00D - R0019 - Staff Room Annexe

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00D/R0020/Wall Linings Internal/S7				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00D/R0020/Wall Linings Internal/S7				Chrysotile (white asbestos)	
B00D - R0020 - Duplicating Workroom						
Wall Linings Internal	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00D/R0020/Wall Linings Internal/S7				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00D/R0020/Wall Linings Internal/S7				Chrysotile (white asbestos)	
B00D - R0021 - Home Base						
No Asbestos						
B00D - R0022 - Home Base						
Wall Linings Internal	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00E/R0003/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00D - R0023 - External Movement						
No Asbestos						
B00D - R0024 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	76m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00E/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00D - R0025 - Home Base						
Wall Linings Internal	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00E/R0003/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00D - R0026 - Home Base						
Wall Linings Internal	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00E/R0003/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00D - R0027 - Cleaning Distributed Store						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00D/R0038/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)	
B00D - R0028 - Sports Store						
No Asbestos						
B00D - R0029 - Home Base						
Wall Linings Internal	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00E/R0003/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00D - R0030 - Home Base						
Wall Linings Internal	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00E/R0003/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00D - R0031 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3957/B00E/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00D - R0032 - Duplicating Workroom						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00D - R0033 - General Storeroom

No Asbestos

B00D - R0034 - Home Base

Wall Linings Internal	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3957/B00E/R0003/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0035 - Practical Activities - 1hb

No Asbestos

B00D - R0036 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3957/B00E/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0037 - Home Base

Wall Linings Internal	Flat AC Sheeting	2m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3957/B00E/R0003/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0038 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3957/B00D/R0038/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		

B00D - R0039 - General Storeroom

No Asbestos

B00D - R0040 - General Assistant/Bulk Store

No Asbestos

B00D - R0041 - External Movement

No Asbestos

B00D - R0042 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3957/B00D/R0042/Ceiling Structures/Linings/S11				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0043 - Special Programs Room

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
3957/B00D/R0043/Floor Coverings Res/Textile/S12				No Asbestos Detected		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Building Services - 1963 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00E - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	37m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3957/B00E/R0001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0002 - Home Base

Wall Linings Internal	Flat AC Sheeting	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3957/B00E/R0003/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0003 - Home Base

Wall Linings Internal	Flat AC Sheeting	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3957/B00E/R0003/Wall Linings Internal/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00E - R0004 - Withdrawal Space - 1hb

No Asbestos

B00E - R0005 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3957/B00E/R0006/Wall Linings Internal/S3				Chrysotile (white asbestos)		

B00E - R0006 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3957/B00E/R0006/Wall Linings Internal/S3				Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1963 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Creiling Void	No Asbestos Found

Interior

B00J - R0001 - Drinking Facilities

No Asbestos

B00J - R0002 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Library - 2003 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00L - R0004 - Reading Area

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00L - R0005 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00L - R0006 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00L - R0007 - Communications Room

No Asbestos

B00L - R0008 - K.L.A. Store

No Asbestos

B00L - R0009 - External Movement

No Asbestos

B00L - R0010 - Disabled Toilet

No Asbestos

B00L - R0011 - Cleaning Distributed Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00M - Administration/General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00M - R0001 - Entry Vestibule

No Asbestos

B00M - R0002 - Interview

No Asbestos

B00M - R0003 - Principal

No Asbestos

B00M - R0004 - Deputy Principal - Type 1

No Asbestos

B00M - R0005 - Staff Room

No Asbestos

B00M - R0006 - Staff Room Annexe

No Asbestos

B00M - R0007 - Security Store

No Asbestos

B00M - R0008 - Interview/Office - Type 3

No Asbestos

B00M - R0009 - Main Switch Board

No Asbestos

B00M - R0010 - Cleaning Distributed Store

No Asbestos

B00M - R0011 - Staff Toilet

No Asbestos

B00M - R0012 - Access Shower/Toilet

No Asbestos

B00M - R0013 - Sick Bay

No Asbestos

B00M - R0014 - Clerical Office

No Asbestos

B00M - R0015 - Movement

No Asbestos

B00M - R0016 - Staff Toilet

No Asbestos

B00M - R0017 - Staff Toilet

No Asbestos

B00M - R0018 - Home Base

No Asbestos

B00M - R0019 - Home Base Store

No Asbestos

B00M - R0020 - Practical Activities - 1hb

No Asbestos

B00M - R0021 - Withdrawal Space - 2hb

No Asbestos

B00M - R0022 - Home Base

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00M - R0023 - Home Base Store						
No Asbestos						
B00M - R0024 - Practical Activities - 1hb						
No Asbestos						
B00M - R0025 - External Movement						
No Asbestos						
B00M - R0026 - External Movement						
No Asbestos						
B00M - R0027 - Staff Kitchen						
No Asbestos						
B00M - R0028 - Duplicating Workroom						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Pupil Facilities - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00N - R0001 - External Movement

No Asbestos

B00N - R0002 - Toilets - Boys

No Asbestos

B00N - R0003 - Toilets - Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D13613 - Learning Unit - Standard With P.A.A. : Placement Date - 14/02/2013

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Learning space/withdrawal/entry

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

R2 - Home Base Store

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

OS 603 - D13838 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 9/10/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017