


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wheeler Heights Public School (4249)
Region : Northern Sydney
State Electorate : Wakehurst
Local Government Area : Warringah

Initial Survey : Noel Arnold & Associates : 10 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 09 - Feb - 2017

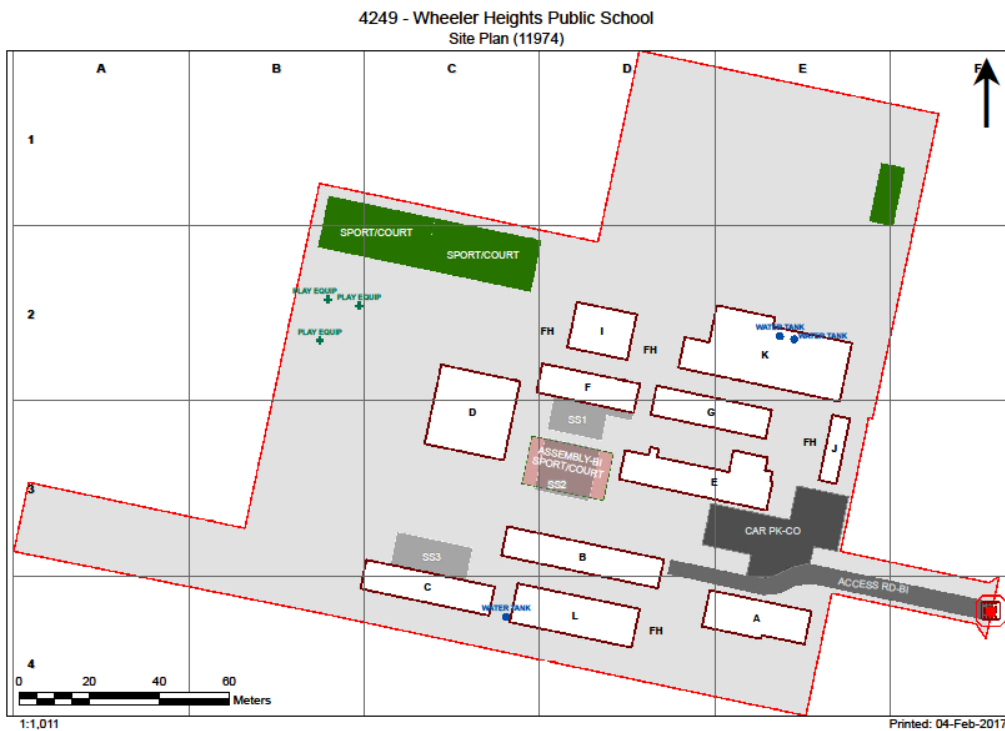

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1973 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 4249/B00A/Eaves Linings/S1	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
In fill panel below window	Flat AC Sheeting 4249/B00A/Under Window Fill/S2	16m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable verge lining	Flat AC Sheeting 4249/B00A/Gable verge lining/S11	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling void - Pitched roof	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible No access door or floor hatch available					

Interior

B00A - R0001 - Staff Room Annexe (17.04 m2)

No Asbestos

B00A - R0002 - General Storeroom (15.49 m2)

No Asbestos

B00A - R0003 - Duplicating Workroom (13.4 m2)

No Asbestos

B00A - R0004 - Clerical Office (13.91 m2)

No Asbestos

B00A - R0005 - Community Clinic (16.59 m2)

No Asbestos

B00A - R0006 - Staff Toilet (5.76 m2)

No Asbestos

B00A - R0007 - Staff Toilet (8.48 m2)

No Asbestos

B00A - R0008 - Staff Room (48.25 m2)

No Asbestos

B00A - R0009 - Staff Shower/Change (9.83 m2)

Floor Coverings Res/Textile	Vinyl Tiles 4249/B00A/R0009/Floor Coverings Res/Textile/S3	No Asbestos Detected				
-----------------------------	---	-----------------------------	--	--	--	--

B00A - R0010 - Movement (16.1 m2)

No Asbestos

B00A - R0011 - Interview (11.04 m2)

No Asbestos

B00A - R0012 - Entry Vestibule (18.97 m2)

No Asbestos

B00A - R0013 - Clerical Office (13.4 m2)

No Asbestos

B00A - R0014 - Principal (17.14 m2)

No Asbestos

B00A - R0015 - Movement (13.11 m2)

No Asbestos

B00A - R0016 - Movement (24.13 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4249/B00A/Eaves Linings/S1	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	--------------	--------------------	---------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0017 - Main Switch Board (2.25 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4249/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
Electrical Mounting Board	Encapsulated Insulation material within unit	3Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4249/B00A/R0017/Electrical Mounting Board/S10					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1973 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4249/B00A/Eaves Linings/S1	80m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Verge strip	Flat AC Sheeting 4249/B00B/Verge strip/S12	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling void - Pitched roof	No Asbestos Found					
Underfloor Voics - Ground debris	AC Fragments/Debris 4249/B00B/Underfloor Voics - Ground debris/S13	60m2	West	Minimal Damage (2)	Medium (2)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting 4249/B00B/Underfloor Voids - Packing to Floor Joists/S14	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00B - R0001 - Movement (1.18 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4249/B00A/Eaves Linings/S1	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	--------------	--------------------	---------	--

B00B - R0002 - General Storeroom (6.87 m2)

No Asbestos

B00B - R0003 - Staff Room Annexe (17.75 m2)

No Asbestos

B00B - R0004 - Movement (5.91 m2)

No Asbestos

B00B - R0005 - Home Base (57.75 m2)

No Asbestos

B00B - R0006 - Home Base Store (5.14 m2)

No Asbestos

B00B - R0007 - Personal Effects Storage (4.08 m2)

No Asbestos

B00B - R0008 - Movement (5.06 m2)

No Asbestos

B00B - R0009 - Movement (1.46 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4249/B00A/Eaves Linings/S1	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	--------------	--------------------	---------	--

B00B - R0010 - Personal Effects Storage (4.13 m2)

No Asbestos

B00B - R0011 - General Storeroom (5.2 m2)

No Asbestos

B00B - R0012 - Communal Space (116.28 m2)

No Asbestos

B00B - R0013 - General Storeroom (5.19 m2)

No Asbestos

B00B - R0014 - Personal Effects Storage (4.09 m2)

No Asbestos

B00B - R0015 - Movement (4.99 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0016 - Movement (1.46 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00A/Eaves Linings/S1					Chrysotile (white asbestos)	
B00B - R0017 - Personal Effects Storage (4.04 m2)						
No Asbestos						
B00B - R0018 - Home Base Store (5.13 m2)						
No Asbestos						
B00B - R0019 - Home Base (57.75 m2)						
No Asbestos						
B00B - R0020 - P.E. Store (21.53 m2)						
No Asbestos						
B00B - R0021 - Movement (3.33 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00B/R0021/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
B00B - R0022 - Movement (1.18 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00A/Eaves Linings/S1					Chrysotile (white asbestos)	
B00B - R0023 - General Storeroom (5.4 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1973 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4249/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
Ceiling Voids - pitched Roof	No Asbestos Found					
Underfloor Voids - Debris A/C	AC Fragments/Debris	100m2	North	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	4249/B00C/Underfloor Voids - Debris A/C/S15					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids - A/C Sheeting	Corrugated AC Sheeting	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4249/B00C/Underfloor Voids - A/C Sheeting/S16					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4249/B00C/Underfloor Voids - Packing to Floor Joists/S17					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Interior

B00C - R0001 - Home Base (57.8 m2)

No Asbestos

B00C - R0002 - Home Base Store (5.27 m2)

No Asbestos

B00C - R0003 - Personal Effects Storage (7.34 m2)

No Asbestos

B00C - R0004 - Movement (6.06 m2)

No Asbestos

B00C - R0005 - Movement (1.47 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4249/B00A/Eaves Linings/S1					Chrysotile (white asbestos)

B00C - R0006 - Home Base Store (5.27 m2)

No Asbestos

B00C - R0007 - Home Base (57.89 m2)

No Asbestos

B00C - R0008 - Home Base (57.73 m2)

No Asbestos

B00C - R0009 - Home Base Store (5.26 m2)

No Asbestos

B00C - R0010 - Personal Effects Storage (7.48 m2)

No Asbestos

B00C - R0011 - Movement (5.81 m2)

No Asbestos

B00C - R0012 - Movement (1.48 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4249/B00A/Eaves Linings/S1					Chrysotile (white asbestos)

B00C - R0013 - Home Base Store (5.26 m2)

No Asbestos

B00C - R0014 - Home Base (57.1 m2)

No Asbestos

B00C - R9001 - General Storeroom (57.71 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	58m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00C/R9001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1973 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	80m2	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4249/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
Underfloor voids < 300mm	Non Accessible Area					
	- No access area < 300mm Underfloor voids require inspection requires optical cable camera due to height restriction.					

Interior**B00D - R0001 - Practical Activities - 1hb (15.17 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4249/B00D/R0001/Ceiling Structures/Linings/S29					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00D - R0002 - Home Base (56.29 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4249/B00D/R0002/Ceiling Structures/Linings/S30					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00D - R0003 - Home Base Store (15.31 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4249/B00D/R0003/Ceiling Structures/Linings/S31					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4249/B00D/R0003/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00D - R0004 - Home Base (59.8 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4249/B00D/R0004/Ceiling Structures/Linings/S32					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00D - R0005 - Practical Activities - 1hb (14.78 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4249/B00D/R0005/Ceiling Structures/Linings/S33					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00D - R0006 - Toilets - Girls (3.92 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4249/B00D/R0006/Ceiling Structures/Linings/S34					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00D - R0007 - Distribution Board (0.22 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	4249/B00D/R0007/Ceiling Structures/Linings/S35					

B00D - R0008 - Home Base (59.8 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4249/B00D/R0008/Ceiling Structures/Linings/S36					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00D - R0009 - Practical Activities - 1hb (15.15 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4249/B00D/R0009/Ceiling Structures/Linings/S37					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00D - R0010 - Home Base Store (15.31 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	4249/B00D/R0010/Ceiling Structures/Linings/S38					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00D/R0003/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
B00D - R0011 - Toilets - Boys (3.9 m2)						
Ceiling Structures/Linings	Vermiculite					
4249/B00D/R0011/Ceiling Structures/Linings/S39				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0012 - Home Base (57.48 m2)						
Ceiling Structures/Linings	Vermiculite					
4249/B00D/R0012/Ceiling Structures/Linings/S40				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0013 - Practical Activities - 1hb (14.37 m2)						
Ceiling Structures/Linings	Vermiculite					
4249/B00D/R0013/Ceiling Structures/Linings/S41				Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B00D - R0014 - Movement (152.44 m2)						
Under Window Fill	Flat AC Sheeting	15m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00A/Under Window Fill/S2				Chrysotile (white asbestos)		
B00D - R1001 - External Movement (27.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00D/R1004/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)		
B00D - R1002 - Toilets - Boys (3.3 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00D/R1004/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)		
B00D - R1003 - Distribution Board (0.83 m2)						
<i>Note: No inspection of live electrical installation.</i>						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00D/R1004/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)		
B00D - R1004 - Movement (14.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00D/R1004/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)		
B00D - R1005 - Cleaning Distributed Store (2.06 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00D/R1004/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)		
B00D - R1006 - Toilets - Girls (3.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00D/R1004/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)		
B00D - R1007 - K.L.A. Store (12.71 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00D/R1004/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)		
B00D - R1008 - K.L.A. Store (12.79 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00D/R1004/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)		
B00D - R1010 - Library Office/Workroom (25.6 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00D/R1004/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)		
B00D - R1012 - Movement (43.06 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00D/R0001/Ceiling Structures/Linings/S28					Chrysotile (white asbestos)	
B00D - R1013 - Home Base (51.79 m2)						
No Asbestos						
B00D - R1014 - Practical Activities - 2hb (25.42 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00D/R0001/Ceiling Structures/Linings/S28					Chrysotile (white asbestos)	
B00D - R1015 - Home Base (51.79 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00D/R0001/Ceiling Structures/Linings/S28					Chrysotile (white asbestos)	
B00D - R1016 - Home Base Store (6.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00D/R0001/Ceiling Structures/Linings/S28					Chrysotile (white asbestos)	
B00D - R1017 - Withdrawal Space - 2hb (12.18 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	R1017	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00D/R0001/Ceiling Structures/Linings/S28					Chrysotile (white asbestos)	
B00D - R1018 - Home Base (52.66 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - General Learning - 1973 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4249/B00A/Eaves Linings/S1	70m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Verge strip	Flat AC Sheeting 4249/B00E/Verge strip/S18	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting 4249/B00E/Underfloor Voids/S19	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids Pitched Roof	No Asbestos Found					
Underfloor Voids	AC Fragments/Debris 4249/B00E/Underfloor Voids/S20	2m2	Variable positions	Minimal Damage (2)	Medium (2)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	AC Fragments/Debris 4249/B00E/Underfloor Voids/S21	20m2	North under R0017	Minimal Damage (2)	Medium (2)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	AC Fragments/Debris 4249/B00E/Underfloor Voids/S22	20m2	Under R0002	Minimal Damage (2)	Medium (2)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	AC Fragments/Debris 4249/B00E/Underfloor Voids/S23	100m2	Throughout	Minimal Damage (2)	Medium (2)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00E - R0001 - Toilets - Boys/Girls (1.62 m2)

No Asbestos

B00E - R0002 - Home Base (98.09 m2)

No Asbestos

B00E - R0003 - Home Base (56.93 m2)

No Asbestos

B00E - R0004 - Personal Effects Storage (8.58 m2)

No Asbestos

B00E - R0005 - Movement (9.78 m2)

No Asbestos

B00E - R0006 - Cleaning Distributed Store (0.54 m2)

No Asbestos

B00E - R0007 - Movement (0.9 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4249/B00A/Eaves Linings/S1	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	--------------	--------------------	---------	--

B00E - R0008 - Staff Room Annexe (14.75 m2)

No Asbestos

B00E - R0009 - General Storeroom (0.93 m2)

No Asbestos

B00E - R0010 - Toilets - Boys/Girls (3.6 m2)

No Asbestos

B00E - R0011 - Home Base (57.46 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00E - R0012 - Practical Activities - 1hb (32.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00E/R0012/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00E - R0013 - Movement (12.3 m2)						
No Asbestos						
B00E - R0014 - Movement (4.68 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00A/Eaves Linings/S1					Chrysotile (white asbestos)	
B00E - R0015 - P.E. Store (21.4 m2)						
No Asbestos						
B00E - R0016 - Toilets - Boys/Girls (3.29 m2)						
Wall Linings Internal	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00E/R0016/Wall Linings Internal/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00E - R0017 - Movement (61.58 m2)						
No Asbestos						
B00E - R0018 - Movement (3.96 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00A/Eaves Linings/S1					Chrysotile (white asbestos)	
B00E - R9001 - Canteen Office/Store (2.98 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00B/R0021/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00A/Eaves Linings/S1					Chrysotile (white asbestos)	
B00E - R9002 - Canteen Office/Store (3.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00B/R0021/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00A/Eaves Linings/S1					Chrysotile (white asbestos)	
B00E - R9003 - Canteen (19.36 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00B/R0021/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00A/Eaves Linings/S1					Chrysotile (white asbestos)	
B00E - R9004 - Movement (25.99 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00A/Eaves Linings/S1					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1973 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 4249/B00A/Eaves Linings/S1	50m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Verge strip	Flat AC Sheeting 4249/B00F/Verge strip/S25	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Underfloor Voids	AC Fragments/Debris 4249/B00F/Underfloor Voids/S24	40m2	Throughout	Minimal Damage (2)	Medium (2)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00F - R0001 - Movement (1.36 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4249/B00A/Eaves Linings/S1	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	--------------	--------------------	---------	--

B00F - R0002 - Movement (2.66 m2)

No Asbestos

B00F - R0003 - Personal Effects Storage (9.45 m2)

No Asbestos

B00F - R0004 - Home Base (56.48 m2)

No Asbestos

B00F - R0005 - Home Base (56.49 m2)

No Asbestos

B00F - R0006 - Home Base Store (3.57 m2)

No Asbestos

B00F - R0007 - General Storeroom (5.27 m2)

No Asbestos

B00F - R0008 - General Storeroom (9.46 m2)

No Asbestos

B00F - R0009 - Movement (5.42 m2)

No Asbestos

B00F - R0010 - Cleaning Distributed Store (0.46 m2)

No Asbestos

B00F - R0011 - Cleaning Distributed Store (0.46 m2)

No Asbestos

B00F - R0012 - Movement (1.35 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4249/B00A/Eaves Linings/S1	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	--------------	--------------------	---------	--

B00F - R0013 - Home Base (57.65 m2)

No Asbestos

B00F - R9001 - Withdrawal Space - 1hb (54.03 m2)

Ceiling Structures/Linings	Flat AC Sheeting 4249/B00A/Eaves Linings/S1	55m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	--------------	--------------------	---------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1973 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4249/B00A/Eaves Linings/S1				Chrysotile (white asbestos)	
Verge strip	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	4249/B00G/Verge strip/S26				Chrysotile (white asbestos)	

Interior

B00G - R0001 - Home Base (57.09 m2)

No Asbestos

B00G - R0002 - Home Base Store (4.74 m2)

No Asbestos

B00G - R0003 - Personal Effects Storage (9.87 m2)

No Asbestos

B00G - R0004 - Movement (4.35 m2)

No Asbestos

B00G - R0005 - Movement (1.49 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4249/B00A/Eaves Linings/S1				Chrysotile (white asbestos)	

B00G - R0006 - Home Base Store (4.74 m2)

No Asbestos

B00G - R0007 - Home Base (56.21 m2)

No Asbestos

B00G - R0008 - Home Base (84.72 m2)

No Asbestos

B00G - R0009 - Toilets - Boys/Girls (2.96 m2)

Wall Linings Internal	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4249/B00E/R0016/Wall Linings Internal/S9				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00G - R0010 - General Storeroom (2.44 m2)

No Asbestos

B00G - R0011 - General Storeroom (9.93 m2)

No Asbestos

B00G - R0012 - Personal Effects Storage (8.37 m2)

No Asbestos

B00G - R0013 - Cleaning Distributed Store (0.66 m2)

No Asbestos

B00G - R0014 - Movement (1.58 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4249/B00A/Eaves Linings/S1				Chrysotile (white asbestos)	

B00G - R0015 - General Storeroom (0.56 m2)

No Asbestos

B00G - R0016 - General Storeroom (0.56 m2)

No Asbestos

4249 Wheeler Heights Public School

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R0017 - General Storeroom (0.56 m2)						
No Asbestos						
B00G - R9001 - General Storeroom (14.58 m2)						
No Asbestos						
B00G - R9002 - General Assistant/Bulk Store (9.84 m2)						
No Asbestos						
B00G - R9003 - Kiln Room (3.39 m2)						
No Asbestos						
B00G - R9004 - Craft Store (51.99 m2)						
No Asbestos						
B00G - R9005 - Special Programs Room (53.84 m2)						
No Asbestos						
B00G - R9006 - Out Of School Hours Care Centre (69.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	70m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00A/Eaves Linings/S1					Chrysotile (white asbestos)	
B00G - R9007 - Toilets - Girls (18.46 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00A/Eaves Linings/S1					Chrysotile (white asbestos)	
B00G - R9009 - General Storeroom (7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	R9009	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00G/R9009/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)	
B00G - R9010 - Movement (11.18 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	R9010	Good Condition (1)	Low (1)	Low Priority (2-3)
4249/B00G/R9009/Ceiling Structures/Linings/S27					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00I - R0001 - Movement (38.49 m2)

No Asbestos

B00I - R0002 - Practical Activities - 1hb (19.4 m2)

No Asbestos

B00I - R0003 - Home Base Store (6.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00I - R0004 - Home Base (59.22 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00I - R0005 - Withdrawal Space - 2hb (11.36 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00I - R0006 - Home Base (59.21 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00I - R0007 - Home Base Store (6.02 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00I - R0008 - Practical Activities - 1hb (19.41 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1973 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - No Voids

Ceiling Voids No Asbestos Found

Interior

B00J - R0001 - Drinking Facilities (8.01 m2)

No Asbestos

B00J - R0002 - Toilets - Girls (32.46 m2)

No Asbestos

B00J - R0003 - Toilets - Boys (32.41 m2)

No Asbestos

B00J - R0004 - Drinking Facilities (8.01 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities/Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids

Interior**B00K - R0001 - Communal Space (214.43 m2)**

No Asbestos

B00K - R0002 - Raised Platform (54.07 m2)

No Asbestos

B00K - R0003 - Hall Chair Store (10.99 m2)

No Asbestos

B00K - R0004 - P.E. Store (17.26 m2)

No Asbestos

B00K - R0005 - Communal/Performance Store (10.99 m2)

No Asbestos

B00K - R0006 - Toilets - Girls (10.63 m2)

No Asbestos

B00K - R0007 - Toilets - Boys (6.53 m2)

No Asbestos

B00K - R0008 - Sound Cupboard (2.03 m2)

No Asbestos

B00K - R0009 - Access Shower/Toilet (6.91 m2)

No Asbestos

B00K - R0010 - Cleaning Distributed Store (6.86 m2)

No Asbestos

B00K - R0011 - Canteen (44.03 m2)

No Asbestos

B00K - R0012 - Canteen Office/Store (10.5 m2)

No Asbestos

B00K - R0013 - External Movement (222.03 m2)

No Asbestos

B00K - R0014 - Toilet - Lobby (1.45 m2)

No Asbestos

B00K - R0015 - Toilet - Lobby (1.65 m2)

No Asbestos

B00K - R0016 - Ramp (12.05 m2)

No Asbestos

B00K - R0017 - Movement (13.13 m2)

No Asbestos

B00K - R0018 - Special Programs Room (96.33 m2)

No Asbestos

B00K - R9001 - Distribution Board (6.99 m2)

No Asbestos

Note: No inspection of live electrical installation.

B00K - R9002 - General Storeroom (38.73 m2)

No Asbestos

B00K - R9003 - Plant (32.35 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Library/Special Purpose - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - No Voids

Interior

B00L - R0001 - Reading Area (229.73 m2)

No Asbestos

B00L - R0002 - Distribution Board (0.64 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00L - R0003 - Cleaning Distributed Store (3.14 m2)

No Asbestos

B00L - R0004 - Movement (2.32 m2)

No Asbestos

B00L - R0005 - Special Programs Room - Type 1 (15.44 m2)

No Asbestos

B00L - R0006 - General Storeroom (8.75 m2)

No Asbestos

B00L - R0007 - Staff Toilet (8.43 m2)

No Asbestos

B00L - R0008 - Staff Toilet (5.03 m2)

No Asbestos

B00L - R0009 - General Storeroom (21 m2)

No Asbestos

B00L - R0010 - Communications Room (8.19 m2)

No Asbestos

B00L - R0011 - Library Office/Workroom (26.53 m2)

No Asbestos

B00L - R0012 - External Movement (20.28 m2)

No Asbestos

B00L - R0013 - Special Programs Room - Type 1 (16.19 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

4249_ASB_150514_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017