


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wilkins Public School (4543)
Region : Sydney
State Electorate : Summer Hill
Local Government Area : Marrickville

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 09 - Jul - 2016

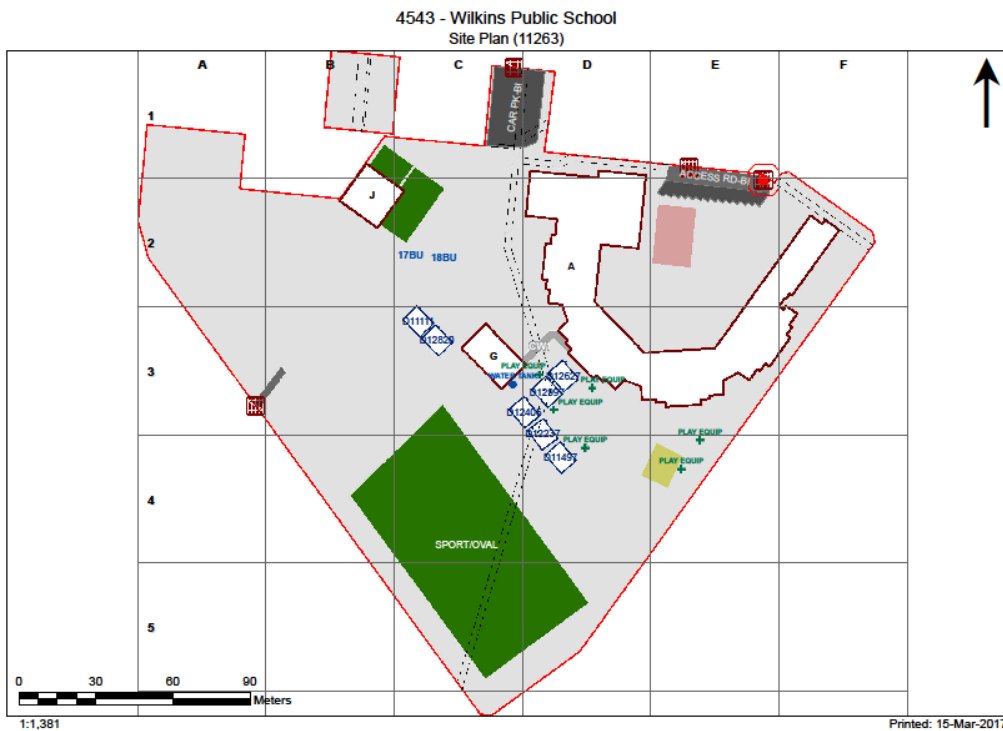

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Communal Facilities - 1982 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior

B00A - M0001 - Movement (11.05 m2)

No Asbestos

B00A - R0001 - Movement (11.33 m2)

No Asbestos

B00A - R0002 - Movement (8.54 m2)

No Asbestos

B00A - R0003 - Community Clinic (15.84 m2)

No Asbestos

B00A - R0004 - Staff Toilet (2.72 m2)

No Asbestos

B00A - R0005 - Disabled Toilet (3.86 m2)

No Asbestos

B00A - R0006 - Interview (12.6 m2)

No Asbestos

B00A - R0007 - Principal (20.83 m2)

No Asbestos

B00A - R0008 - Movement (5.91 m2)

No Asbestos

B00A - R0009 - Entry Vestibule (15.67 m2)

No Asbestos

B00A - R0010 - Movement (8.09 m2)

No Asbestos

B00A - R0011 - General Storeroom (12.87 m2)

No Asbestos

B00A - R0012 - Staff Room Annexe (12.6 m2)

No Asbestos

B00A - R0013 - Clerical Office (13.16 m2)

No Asbestos

B00A - R0014 - Sick Bay (12.64 m2)

No Asbestos

B00A - R0015 - Duplicating Workroom (32.14 m2)

No Asbestos

B00A - R0016 - Deputy Principal (12.46 m2)

No Asbestos

B00A - R0017 - Staff Toilet (4.05 m2)

No Asbestos

B00A - R0018 - Staff Toilet (4.12 m2)

No Asbestos

B00A - R0019 - Movement (23.61 m2)

No Asbestos

B00A - R0020 - Staff Room (66.18 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0021 - Distribution Board (0.76 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00A - R0022 - Cleaning Distributed Store (4.88 m2)						
No Asbestos						
B00A - R0023 - Movement (6.72 m2)						
No Asbestos						
B00A - R0024 - Home Base Store (5.65 m2)						
No Asbestos						
B00A - R0025 - Home Base (59.54 m2)						
Ceiling Structures/Linings	Vermiculite					
		4543/B00A/R0025/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0026 - Movement (15.39 m2)						
No Asbestos						
B00A - R0027 - Withdrawal Space - 1hb (11.03 m2)						
Ceiling Structures/Linings	Vermiculite					
		4543/B00A/R0025/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0028 - Home Base (57.69 m2)						
Ceiling Structures/Linings	Vermiculite					
		4543/B00A/R0025/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0029 - General Storeroom (2.82 m2)						
No Asbestos						
B00A - R0030 - Home Base Store (4.98 m2)						
No Asbestos						
B00A - R0031 - Withdrawal Space - 1hb (14.77 m2)						
Ceiling Structures/Linings	Vermiculite					
		4543/B00A/R0025/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0032 - Movement (25.72 m2)						
Ceiling Structures/Linings	Vermiculite					
		4543/B00A/R0025/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0033 - Practical Activities - 1hb (39.85 m2)						
Ceiling Structures/Linings	Vermiculite					
		4543/B00A/R0025/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0034 - Movement (25.72 m2)						
Ceiling Structures/Linings	Vermiculite					
		4543/B00A/R0025/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0035 - Home Base Store (4.98 m2)						
No Asbestos						
B00A - R0036 - General Storeroom (2.81 m2)						
No Asbestos						
B00A - R0037 - Home Base (59.44 m2)						
Ceiling Structures/Linings	Vermiculite					
		4543/B00A/R0025/Ceiling Structures/Linings/S1				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0038 - Movement (24.78 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0039 - Withdrawal Space - 1hb (11.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	4543/B00A/R0025/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0040 - Home Base (59.5 m2)						
Ceiling Structures/Linings	Vermiculite					
	4543/B00A/R0025/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0041 - Movement (19.61 m2)						
No Asbestos						
B00A - R0042 - Toilets - Girls (7.17 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4543/B00A/R0048/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)
B00A - R0043 - Home Base Store (4 m2)						
No Asbestos						
B00A - R0044 - Distribution Board (0.92 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00A - R0045 - Toilets - Boys (7.79 m2)						
No Asbestos						
B00A - R0046 - Cleaning Distributed Store (1.79 m2)						
No Asbestos						
B00A - R0047 - Movement (30.31 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4543/B00A/R0047/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)
B00A - R0048 - Staff Toilet (4.14 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4543/B00A/R0048/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)
B00A - R0049 - Distribution Board (0.62 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00A - R0050 - Craft Store (11.6 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	4543/B00A/R0050/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00A - R0051 - Special Programs Room (37.79 m2)						
Ceiling Structures/Linings	Vermiculite					
	4543/B00A/R0025/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0052 - Reading Area (230.86 m2)						
Ceiling Structures/Linings	Vermiculite					
	4543/B00A/R0025/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0053 - K.L.A. Store (13.44 m2)						
Ceiling Structures/Linings	Vermiculite					
	4543/B00A/R0025/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0054 - Seminar/Study (13.99 m2)						
Ceiling Structures/Linings	Vermiculite					
	4543/B00A/R0025/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0055 - Cleaning Supplies (11.04 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	4543/B00A/R0050/Floor Coverings Res/Textile/S3					No Asbestos Detected
B00A - R0056 - Movement (24.9 m2)						
Ceiling Structures/Linings	Vermiculite					
	4543/B00A/R0025/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0057 - Communications Room (38.69 m2)						
Ceiling Structures/Linings	Vermiculite					
	4543/B00A/R0025/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0058 - General Assistant/Bulk Store (7.77 m2)						
No Asbestos						
B00A - R0059 - Library Office/Workroom (27.01 m2)						
Ceiling Structures/Linings	Vermiculite					
	4543/B00A/R0025/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0060 - Communications Room (13.91 m2)						
No Asbestos						
B00A - R0061 - Movement (51.23 m2)						
No Asbestos						
B00A - R0062 - Toilets - Boys (7.8 m2)						
No Asbestos						
B00A - R0063 - Distribution Board (0.87 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00A - R0064 - Toilets - Girls (7.09 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	4543/B00A/R0048/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)
B00A - R0065 - Home Base Store (4.05 m2)						
No Asbestos						
B00A - R0066 - Special Programs Room (29.31 m2)						
Ceiling Structures/Linings	Vermiculite					
	4543/B00A/R0025/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0067 - Special Programs Room (29.84 m2)						
Ceiling Structures/Linings	Vermiculite					
	4543/B00A/R0025/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0068 - Withdrawal Space - 1hb (11.2 m2)						
Ceiling Structures/Linings	Vermiculite					
	4543/B00A/R0025/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0069 - Home Base (57.63 m2)						
Ceiling Structures/Linings	Vermiculite					
	4543/B00A/R0025/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0070 - General Storeroom (2.82 m2)						
No Asbestos						
B00A - R0071 - Home Base Store (5 m2)						
No Asbestos						
B00A - R0072 - Movement (25.63 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite		4543/B00A/R0025/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0073 - Practical Activities - 1hb (39.49 m2)						
Ceiling Structures/Linings	Vermiculite		4543/B00A/R0025/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0074 - Movement (25.63 m2)						
Ceiling Structures/Linings	Vermiculite		4543/B00A/R0025/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0075 - Home Base Store (5 m2)						
No Asbestos						
B00A - R0076 - General Storeroom (2.82 m2)						
No Asbestos						
B00A - R0077 - Home Base (59.29 m2)						
Ceiling Structures/Linings	Vermiculite		4543/B00A/R0025/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0078 - Movement (24.87 m2)						
No Asbestos						
B00A - R0079 - Withdrawal Space - 1hb (11.2 m2)						
Ceiling Structures/Linings	Vermiculite		4543/B00A/R0025/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0080 - Special Programs Room (29.59 m2)						
Ceiling Structures/Linings	Vermiculite		4543/B00A/R0025/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0081 - Special Programs Room (29.38 m2)						
Ceiling Structures/Linings	Vermiculite		4543/B00A/R0025/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0082 - Withdrawal Space - 1hb (14.77 m2)						
Ceiling Structures/Linings	Vermiculite		4543/B00A/R0025/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0083 - Home Base Store (5.59 m2)						
Ceiling Structures/Linings	Vermiculite		4543/B00A/R0025/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0084 - Movement (50.57 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	51m2	All surfaces	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
			4543/B00A/R0047/Ceiling Structures/Linings/S2			Chrysotile (white asbestos)
B00A - R0085 - Cleaning Distributed Store (1.77 m2)						
No Asbestos						
B00A - R0086 - Cleaning Distributed Store (1.8 m2)						
No Asbestos						
B00A - R0087 - Formal Lease Agreement (5.47 m2)						
No Asbestos						
B00A - R0088 - Formal Lease Agreement (60.63 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
B00A - R0089 - Formal Lease Agreement (14.78 m2)						
No Asbestos						
B00A - R0090 - Formal Lease Agreement (11.17 m2)						
No Asbestos						
B00A - R0091 - Formal Lease Agreement (58.17 m2)						
No Asbestos						
B00A - R0092 - Formal Lease Agreement (24.54 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2						Chrysotile (white asbestos)
B00A - R0093 - Formal Lease Agreement (2.82 m2)						
No Asbestos						
B00A - R0094 - Formal Lease Agreement (5 m2)						
No Asbestos						
B00A - R0095 - Formal Lease Agreement (25.5 m2)						
No Asbestos						
B00A - R0096 - Formal Lease Agreement (39.93 m2)						
No Asbestos						
B00A - R0097 - Formal Lease Agreement (25.5 m2)						
No Asbestos						
B00A - R0098 - Formal Lease Agreement (5 m2)						
No Asbestos						
B00A - R0099 - Formal Lease Agreement (2.82 m2)						
No Asbestos						
B00A - R0100 - Formal Lease Agreement (57.87 m2)						
No Asbestos						
B00A - R0101 - Formal Lease Agreement (11.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2						Chrysotile (white asbestos)
B00A - R0102 - Formal Lease Agreement (60.41 m2)						
No Asbestos						
B00A - R0103 - Toilets - Girls (7.29 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0048/Partition Walls (Cubicles)/S4						Chrysotile (white asbestos)
B00A - R0104 - Distribution Board (1.04 m2)						
No Asbestos						Note: No inspection of live electrical installation.
B00A - R0105 - Home Base Store (4.21 m2)						
No Asbestos						
B00A - R0106 - Toilets - Boys (8.45 m2)						
No Asbestos						
B00A - R0107 - Staff Toilet (8.59 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0048/Partition Walls (Cubicles)/S4						Chrysotile (white asbestos)
B00A - R0108 - Formal Lease Agreement (22.12 m2)						
No Asbestos						
B00A - R0109 - Formal Lease Agreement (11.48 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R0110 - Cleaning Distributed Store (1.87 m2)						
No Asbestos						
B00A - R0111 - Main Switch Board (5.62 m2)						
No Asbestos						
B00A - R0112 - Communal Space (453.85 m2)						
No Asbestos						
B00A - R0113 - Movement (31.29 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R0114 - Hall Chair Store (35.12 m2)						
No Asbestos						
B00A - R0115 - Movement (6.61 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R0116 - General Storeroom (7.59 m2)						
No Asbestos						
B00A - R0117 - Cleaning Supplies (24.43 m2)						
No Asbestos						
B00A - R0119 - Toilets - Girls (17.51 m2)						
No Asbestos						
B00A - R0120 - Shower/Change (23.62 m2)						
No Asbestos						
B00A - R0126 - Canteen Office/Store (6.95 m2)						
No Asbestos						
B00A - R0127 - Staff Toilet (3.36 m2)						
No Asbestos						
B00A - R0128 - Canteen Office/Store (3.36 m2)						
No Asbestos						
B00A - R0129 - Canteen (45.62 m2)						
No Asbestos						
B00A - R0130 - Movement (602.89 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	420m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R0131 - Toilets-Unisex (7.32 m2)						
No Asbestos						
B00A - R0132 - General Assistant/Bulk Store (32.37 m2)						
No Asbestos						
B00A - R0133 - General Assistant/Bulk Store (1.53 m2)						
No Asbestos						
B00A - R0134 - Raised Platform (64.46 m2)						
No Asbestos						
B00A - R0135 - Ramp (26.47 m2)						
No Asbestos						
B00A - R1001 - Movement (50.53 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	51m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R1002 - Withdrawal Space - 1hb (14.82 m2)						
No Asbestos						
B00A - R1003 - Home Base Store (5.64 m2)						
No Asbestos						
B00A - R1004 - Home Base (60.48 m2)						
No Asbestos						
B00A - R1005 - Movement (15.58 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R1006 - Withdrawal Space - 1hb (11.02 m2)						
No Asbestos						
B00A - R1007 - Home Base (58.4 m2)						
No Asbestos						
B00A - R1008 - Movement (25.75 m2)						
No Asbestos						
B00A - R1009 - General Storeroom (2.84 m2)						
No Asbestos						
B00A - R1010 - Home Base Store (5 m2)						
No Asbestos						
B00A - R1011 - Practical Activities - 1hb (39.84 m2)						
No Asbestos						
B00A - R1012 - Movement (25.58 m2)						
No Asbestos						
B00A - R1013 - Home Base Store (4.98 m2)						
No Asbestos						
B00A - R1014 - General Storeroom (2.84 m2)						
No Asbestos						
B00A - R1015 - Home Base (58.2 m2)						
No Asbestos						
B00A - R1016 - Movement (25.51 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R1017 - Withdrawal Space - 1hb (11.02 m2)						
No Asbestos						
B00A - R1018 - Movement (15.68 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R1019 - Home Base (60.46 m2)						
No Asbestos						
B00A - R1020 - Toilets - Girls (7.23 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0048/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	
B00A - R1021 - Home Base Store (4.37 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1022 - Distribution Board (0.83 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00A - R1023 - Toilets - Boys (7.73 m2)						
No Asbestos						
B00A - R1024 - Movement (69.23 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	70m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)		
B00A - R1025 - Cleaning Distributed Store (1.89 m2)						
No Asbestos						
B00A - R1026 - Toilets - Boys (7.71 m2)						
No Asbestos						
B00A - R1027 - Distribution Board (0.85 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00A - R1028 - Toilets - Girls (7.16 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0048/Partition Walls (Cubicles)/S4				Chrysotile (white asbestos)		
B00A - R1029 - Home Base Store (4.42 m2)						
No Asbestos						
B00A - R1030 - Home Base (60.28 m2)						
No Asbestos						
B00A - R1031 - Movement (15.48 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)		
B00A - R1032 - Withdrawal Space - 1hb (11.06 m2)						
No Asbestos						
B00A - R1033 - Home Base (58.29 m2)						
No Asbestos						
B00A - R1034 - Movement (25.66 m2)						
No Asbestos						
B00A - R1035 - General Storeroom (2.88 m2)						
No Asbestos						
B00A - R1036 - Home Base Store (5.04 m2)						
No Asbestos						
B00A - R1037 - Practical Activities - 1hb (39.71 m2)						
No Asbestos						
B00A - R1038 - Movement (25.64 m2)						
No Asbestos						
B00A - R1039 - Home Base Store (5.04 m2)						
No Asbestos						
B00A - R1040 - General Storeroom (2.88 m2)						
No Asbestos						
B00A - R1041 - Home Base (58.29 m2)						
No Asbestos						
B00A - R1042 - Movement (25.35 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)		
B00A - R1043 - Withdrawal Space - 1hb (11.2 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R1044 - Movement (15.58 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R1045 - Home Base (60.38 m2)						
No Asbestos						
B00A - R1046 - Withdrawal Space - 1hb (15.03 m2)						
No Asbestos						
B00A - R1047 - Home Base Store (5.63 m2)						
No Asbestos						
B00A - R1048 - Cleaning Distributed Store (1.89 m2)						
No Asbestos						
B00A - R1049 - Movement (69.38 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	70m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R1050 - Toilets - Boys (7.72 m2)						
No Asbestos						
B00A - R1051 - Distribution Board (0.85 m2)						
						Note: No inspection of live electrical installation.
No Asbestos						
B00A - R1052 - Home Base Store (4.45 m2)						
No Asbestos						
B00A - R1053 - Toilets - Girls (7.25 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0048/Partition Walls (Cubicles)/S4					Chrysotile (white asbestos)	
B00A - R1054 - Home Base (60.2 m2)						
No Asbestos						
B00A - R1055 - Movement (15.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00A - R1056 - Withdrawal Space - 1hb (11.13 m2)						
No Asbestos						
B00A - R1057 - Home Base (58.15 m2)						
No Asbestos						
B00A - R1058 - Movement (25.75 m2)						
No Asbestos						
B00A - R1059 - General Storeroom (2.88 m2)						
No Asbestos						
B00A - R1060 - Home Base Store (5.04 m2)						
No Asbestos						
B00A - R1061 - Practical Activities - 1hb (39.77 m2)						
No Asbestos						
B00A - R1062 - Movement (25.75 m2)						
No Asbestos						
B00A - R1063 - Home Base Store (5.04 m2)						
No Asbestos						
B00A - R1064 - General Storeroom (2.88 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R1065 - Home Base (58.07 m2)

No Asbestos

B00A - R1066 - Movement (25.28 m2)

Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00A - R1067 - Withdrawal Space - 1hb (11.1 m2)

No Asbestos

B00A - R1068 - Movement (15.68 m2)

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00A - R1069 - Home Base (60.08 m2)

No Asbestos

B00A - R1070 - General Storeroom (14.98 m2)

No Asbestos

B00A - R1071 - Home Base Store (5.64 m2)

No Asbestos

B00A - R1072 - Movement (60.38 m2)

Ceiling Structures/Linings	Flat AC Sheeting	61m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
4543/B00A/R0047/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00A - R1073 - General Storeroom (1.98 m2)

No Asbestos

B00A - R1074 - Movement (1.19 m2)

No Asbestos

B00A - R1075 - Security Store (16.1 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00G - R0001 - Home Base (61.28 m2)

No Asbestos

B00G - R0002 - Home Base Store (5.76 m2)

No Asbestos

B00G - R0003 - Practical Activities - 1hb (18.8 m2)

No Asbestos

B00G - R0004 - Withdrawal Space - 2hb (11.65 m2)

No Asbestos

B00G - R0005 - Home Base (61.26 m2)

No Asbestos

B00G - R0006 - Home Base Store (5.77 m2)

No Asbestos

B00G - R0007 - Practical Activities - 1hb (18.95 m2)

No Asbestos

B00G - R0008 - External Movement (52.4 m2)

No Asbestos

B00G - R0009 - Sports Store (11.75 m2)

No Asbestos

B00G - R0010 - General Assistant/Bulk Store (16.72 m2)

No Asbestos

B00G - R0011 - Garden Store (11.83 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Building Services - 2000 - Concrete (Concrete)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00J - R9001 - General Assistant/Bulk Store (324.11 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D11111 - Learning Unit - Standard With P.A.A. : Placement Date - 9/07/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D11497 - Learning Unit - Standard With P.A.A. : Placement Date - 30/12/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12237 - Learning Unit - Standard With P.A.A. : Placement Date - 24/12/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12406 - Learning Unit - Standard With P.A.A. : Placement Date - 24/12/2010

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D12627 - Learning Unit - Standard With P.A.A. : Placement Date - 25/02/2009

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 602 - D12820 - Learning Unit - Standard With P.A.A. : Placement Date - 6/01/2012						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						
OS 603 - D12997 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 30/09/2009						
Exterior						
No Asbestos Found.						
Interior						
R1 - Learning space/withdrawal/entry						
No Asbestos Found.						
R2 - Home Base Store						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017