


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wiley Park Public School (4553)
Region : South Western Sydney
State Electorate : Lakemba
Local Government Area : Canterbury

Initial Survey : Noel Arnold & Associates : 18 - Mar - 2008
Reviewed By : Greencap-NAA : 29 - May - 2015

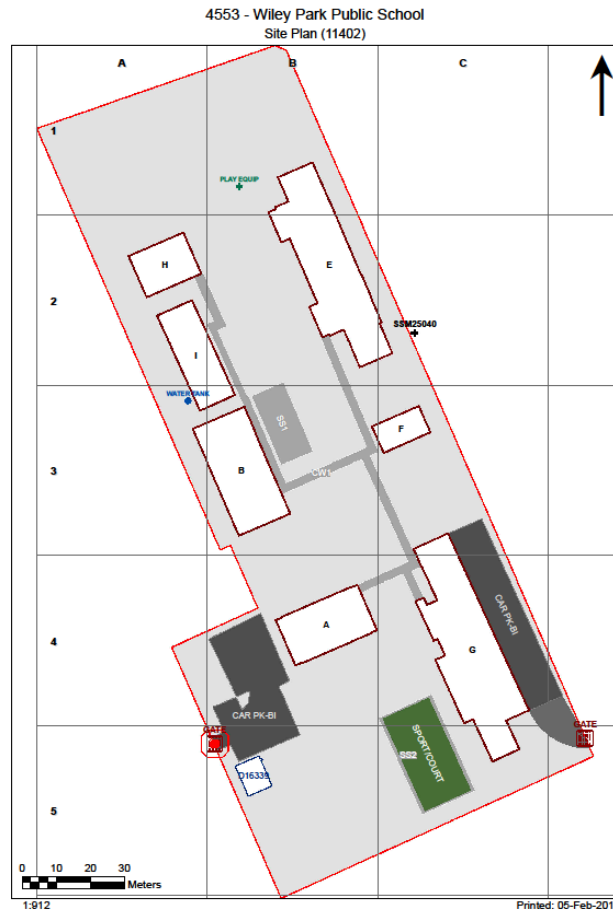

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Staff Facilities - 1984 - Brick/Veneer (Brick/Veneer)**Exterior**

Gable Ends	Flat AC Sheeting 4553/B00B/Gable Ends/S15					No Asbestos Detected
Wall Cladding	Compressed AC Sheet 4553/B00B/Gable Ends/S15					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B00A - R0001 - Movement**

Wall Linings Internal	Flat AC Sheeting 4553/B00B/R0018/Ceiling Structures/Linings/S14					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B00A - R0002 - Staff Room

No Asbestos

B00A - R0003 - Staff Room Annexe

No Asbestos

B00A - R0004 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 4553/B00A/R0008/Wall Linings Internal/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 4553/B00A/R0007/Ceiling Structures/Linings/S16					No Asbestos Detected

B00A - R0005 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 4553/B00A/R0008/Wall Linings Internal/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 4553/B00A/R0007/Ceiling Structures/Linings/S16					No Asbestos Detected

B00A - R0006 - Cleaning Supplies

No Asbestos

B00A - R0007 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting 4553/B00A/R0007/Ceiling Structures/Linings/S16					No Asbestos Detected
----------------------------	--	--	--	--	--	----------------------

B00A - R0008 - Security Store

Wall Linings Internal	Flat AC Sheeting 4553/B00A/R0008/Wall Linings Internal/S3					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 4553/B00A/R0007/Ceiling Structures/Linings/S16					No Asbestos Detected

B00A - R0009 - Principal

No Asbestos

B00A - R0010 - Interview

No Asbestos

B00A - R0011 - Movement

Wall Linings Internal	Flat AC Sheeting 4553/B00B/R0018/Ceiling Structures/Linings/S14					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B00A - R0012 - Clerical Office

No Asbestos

B00A - R0013 - Movement

Wall Linings Internal	Flat AC Sheeting 4553/B00B/R0018/Ceiling Structures/Linings/S14					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

B00A - R0014 - Entry Vestibule

No Asbestos

B00A - R0015 - Clerical Office/Workroom

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0016 - Deputy Principal

No Asbestos

B00A - R0017 - Interview

No Asbestos

B00A - R0018 - Interview

No Asbestos

B00A - R0019 - Movement

No Asbestos

B00A - R0020 - Movement

Wall Linings Internal

Flat AC Sheeting
4553/B00B/R0018/Ceiling Structures/Linings/S14

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Communal Facilities/Pupil Facilities - 1984 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Restricted Access - Raked Ceilings					
Gable Ends	Flat AC Sheeting 4553/B00B/Gable Ends/S15					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Wall Cladding	Compressed AC Sheet 4553/B00B/Gable Ends/S15					No Asbestos Detected

Interior**B00B - R0001 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting 4553/B00B/R0018/Ceiling Structures/Linings/S14					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 4553/B00B/R0013/Wall Linings Internal/S2					No Asbestos Detected

B00B - R0002 - Plant

Ceiling Structures/Linings	Flat AC Sheeting 4553/B00B/R0018/Ceiling Structures/Linings/S14					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 4553/B00B/R0013/Wall Linings Internal/S2					No Asbestos Detected

B00B - R0003 - Shower/Change

Wall Linings Internal	Flat AC Sheeting 4553/B00B/R0013/Wall Linings Internal/S2					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 4553/B00B/R0018/Ceiling Structures/Linings/S14					No Asbestos Detected

B00B - R0004 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting 4553/B00B/R0013/Wall Linings Internal/S2					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 4553/B00B/R0018/Ceiling Structures/Linings/S14					No Asbestos Detected

B00B - R0005 - Hall Chair Store

No Asbestos

B00B - R0006 - Communal Space

No Asbestos

B00B - R0007 - Canteen

No Asbestos

B00B - R0008 - Uniform Shop

No Asbestos

B00B - R0009 - Sports Store

No Asbestos

B00B - R0010 - Cleaning Supplies

No Asbestos

B00B - R0011 - Disabled Toilet

No Asbestos

B00B - R0012 - Movement

Wall Linings Internal	Flat AC Sheeting 4553/B00B/R0018/Wall Linings Internal/S1					No Asbestos Detected
-----------------------	--	--	--	--	--	----------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting					
	4553/B00B/R0018/Ceiling Structures/Linings/S14					No Asbestos Detected
B00B - R0013 - Hall Chair Store						
Wall Linings Internal	Flat AC Sheeting					
	4553/B00B/R0013/Wall Linings Internal/S2					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting					
	4553/B00B/R0018/Ceiling Structures/Linings/S14					No Asbestos Detected
B00B - R0014 - Toilets - Boys						
Wall Linings Internal	Flat AC Sheeting					
	4553/B00B/R0013/Wall Linings Internal/S2					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting					
	4553/B00B/R0018/Ceiling Structures/Linings/S14					No Asbestos Detected
B00B - R0015 - Shower/Change						
Wall Linings Internal	Flat AC Sheeting					
	4553/B00B/R0013/Wall Linings Internal/S2					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting					
	4553/B00B/R0018/Ceiling Structures/Linings/S14					No Asbestos Detected
B00B - R0016 - Distribution Board						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00B - R0017 - Movement						
Wall Linings Internal	Flat AC Sheeting					
	4553/B00B/R0013/Wall Linings Internal/S2					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting					
	4553/B00B/R0018/Ceiling Structures/Linings/S14					No Asbestos Detected
B00B - R0018 - Movement						
Wall Linings Internal	Flat AC Sheeting					
	4553/B00B/R0018/Wall Linings Internal/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting					
	4553/B00B/R0018/Ceiling Structures/Linings/S14					No Asbestos Detected
B00B - R0019 - Raised Platform						
No Asbestos						
B00B - R0020 - Movement						
Wall Linings Internal	Flat AC Sheeting					
	4553/B00B/R0013/Wall Linings Internal/S2					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting					
	4553/B00B/R0018/Ceiling Structures/Linings/S14					No Asbestos Detected
B00B - R0021 - Movement						
Wall Linings Internal	Flat AC Sheeting					
	4553/B00B/R0018/Wall Linings Internal/S1					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting					
	4553/B00B/R0018/Ceiling Structures/Linings/S14					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Pupil Facilities - 1979 - Brick/Block (Brick/Block)

Exterior

Gable verge lining	Flat AC Sheeting 4553/B00G/Gable Verge lining/S7					No Asbestos Detected
Eaves Linings	Flat AC Sheeting	10m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction						
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found 4553/B00E/Balcony - Soffit Linings/S17					Chrysotile (white asbestos)
Eaves Linings	Non Accessible Area - No Eaves - only Balcony Soffit linings.					

Interior

B00E - R0001 - Plant						
No Asbestos						
B00E - R0002 - Movement						
No Asbestos						
B00E - R0003 - Home Base						
No Asbestos						
B00E - R0004 - Home Base						
No Asbestos						
B00E - R0005 - Home Base						
No Asbestos						
B00E - R0006 - Home Base						
No Asbestos						
B00E - R0007 - Home Base						
No Asbestos						
B00E - R0008 - Home Base						
No Asbestos						
B00E - R0009 - Practical Activities - 1hb						
No Asbestos						
B00E - R0010 - Toilets - Girls						
Wall Linings Internal	Flat AC Sheeting 4553/B00E/R0010/Wall Linings Internal/S8					No Asbestos Detected
B00E - R0011 - Toilets - Boys						
Wall Linings Internal	Flat AC Sheeting 4553/B00E/R0010/Wall Linings Internal/S8					No Asbestos Detected
B00E - R0012 - Drinking Facilities						
No Asbestos						
B00E - R0013 - Movement						
No Asbestos						
B00E - R0014 - Movement						
Electrical Cupboard Floor Lining	Flat AC Sheeting 4553/B00E/R0014/Electrical Cupboard Floor Lining/S9	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4553/B00E/R0014/Ceiling Structures/Linings/S10	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 4553/B00E/R0014/Wall Linings Internal/S11	3m2	Exterior Wall & Interior Door Linings	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Electrical Cupboard	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
4553/B00E/R0014/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	
B00E - R0015 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4553/B00E/R0014/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	
B00E - R0016 - Movement						
No Asbestos						
B00E - R0017 - Cleaning Distributed Store						
No Asbestos						
B00E - R0018 - General Storeroom						
No Asbestos						
B00E - R0019 - Practical Activities - 1hb						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4553/B00E/R1001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00E - R0020 - Communal Space						
Ceiling Structures/Linings	Flat AC Sheeting	90m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
4553/B00E/R1001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00E - R0021 - Movement						
No Asbestos						
B00E - R0022 - Withdrawal Space - 1hb						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4553/B00E/R1001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00E - R0023 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4553/B00E/R1001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00E - R0024 - Movement						
No Asbestos						
B00E - R0025 - Cleaning Distributed Store						
No Asbestos						
B00E - R0026 - Movement						
No Asbestos						
B00E - R0027 - Stairs						
No Asbestos						
B00E - R0028 - Stairs						
No Asbestos						
B00E - R1001 - Security Store						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4553/B00E/R1001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	
B00E - R1002 - Home Base						
No Asbestos						
B00E - R1003 - Home Base						
No Asbestos						
B00E - R1004 - Home Base						
No Asbestos						
B00E - R1005 - Home Base						
No Asbestos						
B00E - R1006 - Home Base						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00E - R1007 - Home Base

No Asbestos

B00E - R1008 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4553/B00E/R1001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00E - R1009 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4553/B00E/R1001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00E - R1010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	113m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4553/B00E/R1001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00E - R1011 - Stairs

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4553/B00E/R1001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

B00E - R1012 - Stairs

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4553/B00E/R1001/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - General Learning - 1950 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Restricted Access - Raked Ceilings					
Gable Ends	Flat AC Sheeting 4553/B00F/R0001/Ceiling Structures/Linings/S4	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Eaves Linings	Flat AC Sheeting 4553/B00F/R0001/Ceiling Structures/Linings/S4	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

Interior

B00F - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4553/B00F/R0001/Ceiling Structures/Linings/S4	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Wall Linings Internal	Flat AC Sheeting 4553/B00F/R0004/Wall Linings Internal/S6	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)

B00F - R0002 - Special Programs Room

Ceiling Structures/Linings	Flat AC Sheeting 4553/B00F/R0001/Ceiling Structures/Linings/S4	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Wall Linings Internal	Flat AC Sheeting 4553/B00F/R0004/Wall Linings Internal/S6	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)

B00F - R0003 - Special Programs Room

Ceiling Structures/Linings	Flat AC Sheeting 4553/B00F/R0001/Ceiling Structures/Linings/S4	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Wall Linings Internal	Flat AC Sheeting 4553/B00F/R0004/Wall Linings Internal/S6	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)

B00F - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4553/B00F/R0001/Ceiling Structures/Linings/S4	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Wall Linings Internal	Flat AC Sheeting 4553/B00F/R0004/Wall Linings Internal/S6	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)

B00F - R0005 - Special Programs Room

Ceiling Structures/Linings	Flat AC Sheeting 4553/B00F/R0001/Ceiling Structures/Linings/S4	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---	------	--------------	--------------------	---------	--------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Wall Linings Internal	Flat AC Sheeting	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
4553/B00F/R0004/Wall Linings Internal/S6				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning/Library - 1979 - Brick/Block (Brick/Block)**Exterior**

Gable Ends	Flat AC Sheeting	5m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
------------	------------------	-----	--------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction - Height

Eaves Linings	Flat AC Sheeting	35m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	-------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction - Height

Gable Verge lining	Flat AC Sheeting 4553/B00G/Gable Verge lining/S7					No Asbestos Detected
--------------------	---	--	--	--	--	-----------------------------

Ceiling Voids	No Asbestos Found					
---------------	-------------------	--	--	--	--	--

Underfloor Voids	No Asbestos Found					
------------------	-------------------	--	--	--	--	--

Interior**B00G - R0001 - Plant**

Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	-------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard**B00G - R0003 - Library Office/Workroom**

No Asbestos

B00G - R0004 - K.L.A. Store

No Asbestos

B00G - R0005 - Special Programs Room

No Asbestos

B00G - R0006 - Home Base

No Asbestos

B00G - R0008 - Home Base

No Asbestos

B00G - R0009 - Home Base

No Asbestos

B00G - R0010 - Craft Store

No Asbestos

B00G - R0011 - Cleaning Distributed Store

No Asbestos

B00G - R0012 - Disabled Toilet

No Asbestos

B00G - R0013 - Toilets - Girls

Wall Linings Internal	Flat AC Sheeting 4553/B00G/R0014/Wall Linings Internal/S5					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00G - R0014 - Toilets - Boys

Wall Linings Internal	Flat AC Sheeting 4553/B00G/R0014/Wall Linings Internal/S5					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00G - R0015 - Movement

Wall Linings Internal	Flat AC Sheeting 4553/B00G/R0014/Wall Linings Internal/S5					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00G - R0016 - Movement

No Asbestos

B00G - R0017 - General Storeroom

No Asbestos

B00G - R0018 - Movement

No Asbestos

B00G - R0019 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
	No Asbestos					
	B00G - R0020 - Home Base					
	No Asbestos					
	B00G - R0021 - General Storeroom					
	No Asbestos					
	B00G - R0022 - General Storeroom					
	No Asbestos					
	B00G - R0023 - Staff Toilet					
	No Asbestos					
	B00G - R0024 - General Storeroom					
	No Asbestos					
	B00G - R0025 - Movement					
	No Asbestos					
	B00G - R0026 - Movement					
	No Asbestos					
	B00G - R0027 - Stairs					
	No Asbestos					
	B00G - R0028 - Stairs					
	No Asbestos					
	B00G - R0029 - Home Base					
	No Asbestos					
	B00G - R0030 - Withdrawal Space - 1hb					
	No Asbestos					
	B00G - R0031 - Practical Activities - 2hb					
	No Asbestos					
	B00G - R0032 - Withdrawal Space - 1hb					
	No Asbestos					
	B00G - R0033 - Home Base					
	No Asbestos					
	B00G - R0034 - No Access					
	No Asbestos					
	B00G - R0035 - Home Base Store					
	No Asbestos					
	B00G - R1001 - Home Base					
	No Asbestos					
	B00G - R1003 - Home Base					
	No Asbestos					
	B00G - R1004 - Home Base					
	No Asbestos					
	B00G - R1005 - Home Base					
	No Asbestos					
	B00G - R1007 - Home Base					
	No Asbestos					
	B00G - R1008 - Home Base					
	No Asbestos					
	B00G - R1009 - Security Store					
	No Asbestos					
	B00G - R1010 - Movement					
	No Asbestos					
	B00G - R1011 - Home Base					
	No Asbestos					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R1012 - Home Base						
No Asbestos						
B00G - R1013 - Staff Kitchen						
No Asbestos						
B00G - R1014 - Staff Toilet						
No Asbestos						
B00G - R1015 - General Storeroom						
No Asbestos						
B00G - R1016 - Movement						
No Asbestos						
B00G - R1017 - Stairs						
No Asbestos						
B00G - R1018 - Stairs						
No Asbestos						
B00G - R1019 - Withdrawal Space - 1hb						
No Asbestos						
B00G - R1020 - Practical Activities - 2hb						
No Asbestos						
B00G - R1021 - Withdrawal Space - 1hb						
No Asbestos						
B00G - R1022 - Withdrawal Space - 2hb						
No Asbestos						
B00G - R1023 - Home Base Store						
No Asbestos						
B00G - R1024 - Home Base Store						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - Movement

No Asbestos

B00H - R0002 - Practical Activities - 1hb

No Asbestos

B00H - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0007 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00H - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00I - R0001 - Reading Area

No Asbestos

B00I - R0002 - Library Office/Workroom

No Asbestos

B00I - R0003 - Communications Room

No Asbestos

B00I - R0004 - K.L.A. Store

No Asbestos

B00I - R0005 - Toilet - Lobby

No Asbestos

B00I - R0006 - Cleaning Distributed Store

No Asbestos

B00I - R0007 - Staff Toilet

No Asbestos

B00I - R0008 - No Access

No Asbestos

B00I - R0009 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 600 - D11344 - Learning Unit - Small : Placement Date - 21/09/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - General Learning Space

No Asbestos Found.

OS 601 - D16339 - Learning Unit - Standard/Withdrawal : Placement Date - 24/09/1996

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017