


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Warrawong High School (8480)  
**Region :** Illawarra and South East  
**State Electorate :** Wollongong  
**Local Government Area :** Wollongong

**Initial Survey :** Noel Arnold & Associates : 14 - Apr - 2008  
**Reviewed By :** Greencap-NAA : 26 - Aug - 2014

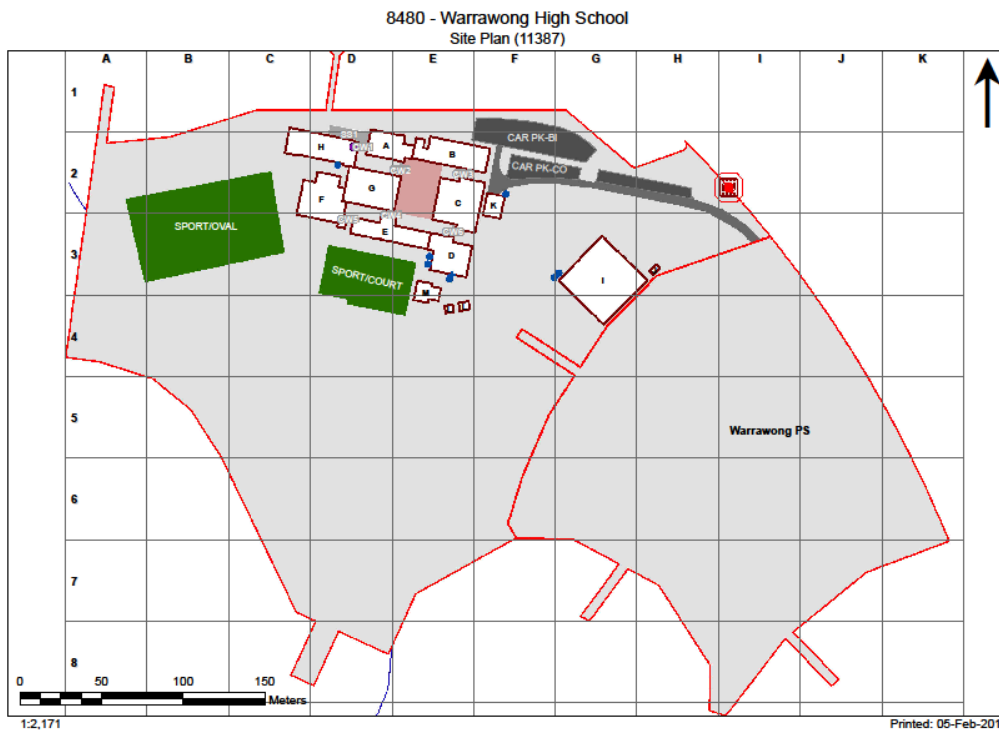

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	<b>Sample No</b>					<b>Test Result</b>

**B00A - Administration - 1972 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	Non Accessible Area - Area inaccessible

**Interior****B00A - R0001 - Administration - Clerical (26.72 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0003 - Leading Teacher (13.43 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0004 - Staff Study (11.59 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0005 - Clinic - Girls (12.74 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0006 - Distribution Board Cupboard (0.53 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00A - R0007 - Staff - Toilet (7.47 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0008 - Cleaning Store - Distributed (1.96 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0009 - Staff - Toilet (7.74 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0010 - Deputy Principal Office (16.99 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0013 - Leading Teacher (14.06 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0014 - Principal Office (18.72 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0015 - General Storeroom (2 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00A - R0016 - Staff - Toilet (1.95 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0017 - Duplicating Workroom (13.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0019 - External Movement (60.01 m2)</b>						
No Asbestos						
<b>B00A - R0020 - Entry (40.41 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8480/B00A/R0020/Floor Coverings Res/Textile/S15	40.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0021 - Administration - Clerical (29.16 m2)</b>						
No Asbestos						
<b>B00A - R0022 - Movement (12 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00A/R0026/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8480/B00A/R0020/Floor Coverings Res/Textile/S15	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0023 - Movement (16.35 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00A/R0026/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8480/B00A/R0020/Floor Coverings Res/Textile/S15	16.35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0024 - Commonroom (9.32 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00A/R0026/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8480/B00A/R0020/Floor Coverings Res/Textile/S15	9.32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0025 - Staff Kitchen (4.45 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00A/R0026/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8480/B00A/R0020/Floor Coverings Res/Textile/S15	4.45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0026 - Movement (22.98 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00A/R0026/Ceiling Structures/Linings/S14					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8480/B00A/R0020/Floor Coverings Res/Textile/S15	22.97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R9001 - Main Switchroom (8.81 m2)</b>						
No Asbestos						
<b>B00A - R9002 - Chemical Store (78.56 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00D/R0008/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R9004 - External Movement (145.41 m2)</b>						
Bulk head	Flat AC Sheeting					
8480/B00A/R9004/Bulk head/S16					<b>No Asbestos Detected</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00B - General Learning - 1972 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	Non Accessible Area - Area inaccessible

**Interior**

**B00B - BR0010 - Store**

No Asbestos

**B00B - BR0011 - Store**

No Asbestos

**B00B - R0001 - Garden Store Room (10.2 m2)**

No Asbestos

**B00B - R0002 - Garden Store Room (43.65 m2)**

No Asbestos

**B00B - R0006 - General Storeroom (5.62 m2)**

No Asbestos

**B00B - R0007 - Stairs (6.08 m2)**

No Asbestos

**B00B - R0009 - External Movement (116.71 m2)**

No Asbestos

**B00B - R0010 - Store (20.07 m2)**

No Asbestos

**B00B - R0011 - Store (9.21 m2)**

No Asbestos

**B00B - R1001 - General Learning Space (55.58 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00B - R1002 - General Storeroom (9.94 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00B - R1003 - General Learning Space (52.78 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00B - R1004 - General Storeroom (3.54 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00B - R1005 - Special Learning Space (30.21 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00B - R1006 - Staff Study (12.95 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00B - R1007 - Toilets - Boys (9.52 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1008 - Cleaning Store - Distributed (4.97 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1009 - Distribution Board Cupboard (0.54 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00B - R1010 - Toilets - Girls (9.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1011 - Staff Study (33.94 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1012 - General Learning Space (53.15 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1016 - General Learning Space (51.9 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1017 - Movement (81.13 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	108m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8480/B00D/R0008/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
<b>B00B - R1018 - External Movement (55.66 m2)</b>						
No Asbestos						
<b>B00B - R1019 - Stairs (27.21 m2)</b>						
No Asbestos						
<b>B00B - R1020 - Performance Workspace (79.65 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	79.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8480/B00B/R1020/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8480/B00B/R1020/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Adhesive-Black	79.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8480/B00B/R1020/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)
<b>B00B - R1021 - Performance Store (6.28 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8480/B00B/R1021/Floor Coverings Res/Textile/S20					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive-Brown					
	8480/B00B/R1021/Floor Coverings Res/Textile/S21					No Asbestos Detected
<b>B00B - R1022 - Performance Store (6.25 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Adhesive-Brown					
	8480/B00B/R1021/Floor Coverings Res/Textile/S21					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet					
	8480/B00B/R1021/Floor Coverings Res/Textile/S20					No Asbestos Detected
<b>B00B - R1023 - Stairs (6.28 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00B/R1020/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R2001 - General Learning Space (52.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R2002 - General Learning Space (52.49 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R2003 - Movement (16.77 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8480/B00D/R0008/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
<b>B00B - R2004 - General Learning Space (52.57 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R2005 - General Learning Space (52.72 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R2006 - Cleaning Store - Distributed (3.23 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8480/B00D/R0008/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
<b>B00B - R2007 - Distribution Board Cupboard (0.91 m2)</b>						
						Note: No inspection of live electrical installation.
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8480/B00D/R0008/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
<b>B00B - R2008 - Interview/Office - Type 1 (12.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R2009 - Staff Study (37.07 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R2010 - Movement (49.91 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8480/B00D/R0008/Floor Coverings Res/Textile/S3	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R2012 - Staff Study (18.9 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8480/B00D/R0008/Floor Coverings Res/Textile/S3	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R2013 - General Learning Space (52.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R2014 - General Learning Space (52.85 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R2015 - Staff Study (19.06 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R2016 - Stairs (23.49 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00B - R2017 - Staff Study (26.1 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00B/R1020/Ceiling Structures/Linings/S18					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8480/B00B/R2017/Floor Coverings Res/Textile/S22	26.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00B - R2018 - Administration - Clerical (26.1 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00B/R1020/Ceiling Structures/Linings/S18					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8480/B00B/R1020/Ceiling Structures/Linings/S18					No Asbestos Detected
<b>B00B - R2019 - Stairs (6.27 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00B/R1020/Ceiling Structures/Linings/S18					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities/Multi Purpose Facilities - 1972 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids	Non Accessible Area - Area inaccessible

**Interior****B00C - R0001 - General Assistants (9.5 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R0002 - Student Canteen (5.89 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00D/R0008/Floor Coverings Res/Textile/S3						Chrysotile (white asbestos)

**B00C - R0003 - Student Canteen (50.97 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00D/R0008/Floor Coverings Res/Textile/S3						Chrysotile (white asbestos)

**B00C - R0004 - Staff - Toilet (5.89 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R0005 - Garden Store Room (3.15 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R0006 - Staff - Toilet (3.53 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00C - R0007 - Sport Equipment Store (17.49 m2)**

No Asbestos

**B00C - R0008 - Distribution Board Cupboard (0.7 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00C - R0009 - Materials Store (17.29 m2)**

No Asbestos

**B00C - R0011 - Chair Store (17.26 m2)**

No Asbestos

**B00C - R0012 - Maintenance Bulk Store (15.33 m2)**

No Asbestos

**B00C - R0013 - Multi-Purpose Space (314.48 m2)**

No Asbestos

**B00C - R0014 - Cleaning Store - Distributed (0.87 m2)**

No Asbestos

**B00C - R0015 - External Movement (188.58 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00C - R0017 - General Storeroom (19.21 m2)</b>						
No Asbestos						
<b>B00C - R0018 - Movement (41.29 m2)</b>						
No Asbestos						
<b>B00C - R0019 - Movement (26.64 m2)</b>						
No Asbestos						
<b>B00C - R1001 - Sport Equipment Store (9.41 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00D/R0008/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1002 - Staff - Toilet (7.34 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00C/R1002/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00D/R0008/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1005 - Distribution Board Cupboard (0.67 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00C - R1006 - Staff - Toilet (6.46 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00D/R0008/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1007 - Sport Equipment Store (8.9 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00D/R0008/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1008 - Cleaning Store - Distributed (2.93 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00D/R0008/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1009 - Movement (66.29 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00D/R1013/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00C - R1010 - Cleaning Store - Distributed (3.16 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00D/R0008/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00C - R1011 - Toilets-Girls (11.13 m2)</b>						
No Asbestos						
<b>B00C - R1012 - Gymnasium (102.95 m2)</b>						
No Asbestos						
<b>B00C - R1013 - Toilets-Boys (10.64 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Technological & Applied Studies - 1972 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior**

**B00D - R0001 - Design L.S. (52.21 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00D - R0002 - Distribution Board Cupboard (0.63 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00D - R0003 - Resource/Project Store (12.73 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles 8480/B00D/R0008/Floor Coverings Res/Textile/S3	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	---

**B00D - R0004 - Materials Technology L.S. (82.19 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00D - R0005 - Materials Store (21.3 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00D - R0006 - Welding Area (10.31 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00D - R0007 - Materials Technology L.S. (82.37 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00D - R0008 - Movement (59.32 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles 8480/B00D/R0008/Floor Coverings Res/Textile/S3	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	---

**B00D - R0009 - Design L.S. (51.91 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00D - R0010 - Computer Learning Space (12.4 m2)**

No Asbestos

**B00D - R0011 - Staff Study (29.28 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00D - R0012 - General Storeroom (2.3 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8480/B00D/R1013/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0013 - Movement (35.39 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8480/B00D/R1013/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R0014 - Stairs (7.79 m2)</b>						
No Asbestos						
<b>B00D - R1004 - Distribution Board Cupboard (0.63 m2)</b>						
No Asbestos						
					Note: No inspection of live electrical installation.	
<b>B00D - R1010 - Materials Technology L.S. (82.91 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8480/B00D/R1013/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1014 - General Storeroom (41.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8480/B00D/R1013/Ceiling Structures/Linings/S1			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1015 - Stairs (17.34 m2)</b>						
No Asbestos						
<b>B00D - R1016 - Wood Technology Bay (110.48 m2)</b>						
No Asbestos						
<b>B00D - R1017 - Dust Extraction Space (4.56 m2)</b>						
No Asbestos						
<b>B00D - R1018 - Store (12.84 m2)</b>						
No Asbestos						
<b>B00D - R1019 - Movement (32.3 m2)</b>						
No Asbestos						
<b>B00D - R1020 - Movement (8.53 m2)</b>						
No Asbestos						
<b>B00D - R1021 - Project Store - Type 1 (25.62 m2)</b>						
No Asbestos						
<b>B00D - R1022 - Design L.S. (53.01 m2)</b>						
No Asbestos						
<b>B00D - R1023 - Movement (6.9 m2)</b>						
No Asbestos						
<b>B00D - R1024 - Resource/Project Store (17.54 m2)</b>						
Ceiling Structures/Linings	Vermiculite		8480/B00D/R1024/Ceiling Structures/Linings/S32			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00D - R1025 - Toilets-Boys (52.28 m2)</b>						
No Asbestos						
<b>B00D - R2001 - Stairs (15.82 m2)</b>						
No Asbestos						
<b>B00D - R2002 - External Movement (43.62 m2)</b>						
Throughout	No Asbestos Found					
Throughout	No Asbestos Found					
Throughout	No Asbestos Found					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1972 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	Non Accessible Area - Area inaccessible

**Interior****B00E - R0001 - General Learning Space (52.42 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00E - R0002 - General Learning Space (51.92 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00E - R0003 - General Learning Space (52.27 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00E - R0004 - General Learning Space (52.64 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00E - R0005 - Cleaning Store - Distributed (8.2 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00E - R0007 - General Learning Space (51.92 m2)**

No Asbestos

**B00E - R0008 - General Learning Space (52.64 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00E - R0010 - General Storeroom (4.16 m2)**

No Asbestos

**B00E - R0011 - Distribution Board Cupboard (0.7 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00E - R0013 - Stairs (12.14 m2)**

No Asbestos

**B00E - R0015 - Movement (122.62 m2)**

No Asbestos

**B00E - R0016 - General Storeroom (17 m2)**

No Asbestos

**B00E - R1002 - General Learning Space (50.85 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00E - R1004 - Distribution Board Cupboard (0.67 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00E - R1005 - Staff - Toilet (12.41 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00D/R1013/Ceiling Structures/Linings/S1	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00E - R1006 - Cleaning Store - Distributed (11.18 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00E/R1006/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00E - R1007 - Staff - Toilet (13.02 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00D/R1013/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R1008 - Staff Study (52.57 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00D/R1013/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R1010 - Stairs (17.07 m2)</b>						
No Asbestos						
<b>B00E - R1012 - General Learning Space (53.66 m2)</b>						
No Asbestos						
<b>B00E - R1013 - Staff Lounge (62.28 m2)</b>						
No Asbestos						
<b>B00E - R1014 - Staff Kitchen (13 m2)</b>						
No Asbestos						
<b>B00E - R1015 - External Movement (133.6 m2)</b>						
No Asbestos						
<b>B00E - R1016 - Toilets-Girls (51.52 m2)</b>						
No Asbestos						
<b>B00E - R1017 - Cleaning Store - Distributed (11.66 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00D/R1024/Ceiling Structures/Linings/S32					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R2001 - Staff Study (52.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00D/R1013/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R2002 - General Learning Space (52.27 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00D/R1013/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R2003 - General Learning Space (52.42 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00D/R1013/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R2004 - General Learning Space (52.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00D/R1013/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R2005 - Distribution Board Cupboard (0.69 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00E - R2006 - Cleaning Store - Distributed (8.05 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00D/R1013/Ceiling Structures/Linings/S1					<b>Limited Samples Taken</b>	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00E - R2007 - Staff Study (12.83 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite  
 8480/B00D/R1013/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00E - R2008 - General Learning Space (52.35 m2)**

Ceiling Structures/Linings Vermiculite  
 8480/B00D/R1013/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00E - R2009 - General Learning Space (52.28 m2)**

Ceiling Structures/Linings Vermiculite  
 8480/B00D/R1013/Ceiling Structures/Linings/S1 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00E - R2012 - Stairs (17.07 m2)**

No Asbestos

**B00E - R2013 - External Movement (129.55 m2)**

No Asbestos

**B00E - R3001 - Stairs (18.17 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Technological & App. Studies - 1972 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids	Non Accessible Area - Area inaccessible
Ceiling Voids	Non Accessible Area - Area inaccessible

**Interior****B00F - R0002 - Movement (24.52 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00F/R1001/Ceiling Structures/Linings/S7	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00F - R0003 - Movement (58.89 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00F/R1001/Ceiling Structures/Linings/S7	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00F - R0004 - Food Technology L.S. (82.73 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00F/R1001/Ceiling Structures/Linings/S7	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00F - R0012 - Cleaning Store - Distributed (3.93 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00F/R1001/Ceiling Structures/Linings/S7	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00F - R0013 - General Learning Space (65.89 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00F/R1001/Ceiling Structures/Linings/S7	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00F - R0014 - Food/Research Space (15.97 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00F/R1001/Ceiling Structures/Linings/S7	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00D/R0008/Floor Coverings Res/Textile/S3						Chrysotile (white asbestos)

**B00F - R0015 - Distribution Board Cupboard (0.54 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00F - R0019 - General Storeroom (41.73 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00F/R1001/Ceiling Structures/Linings/S7	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

Floor Coverings Res/Textile	Vinyl Tiles	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00D/R0008/Floor Coverings Res/Textile/S3						Chrysotile (white asbestos)

**B00F - R0020 - General Storeroom (16.54 m2)**

No Asbestos

**B00F - R0021 - Stairs (2.24 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00F/R0021/Ceiling Structures/Linings/S31	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		

**B00F - R0022 - Stairs (0.58 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00F/R0021/Ceiling Structures/Linings/S31	Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>		



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R0023 - Pantry (12.82 m2)</b>						
No Asbestos						
<b>B00F - R0024 - Preparation (18.9 m2)</b>						
No Asbestos						
<b>B00F - R0025 - Food Technology L.S. (82.09 m2)</b>						
No Asbestos						
<b>B00F - R0026 - Store (22.43 m2)</b>						
No Asbestos						
<b>B00F - R0027 - Store (2.94 m2)</b>						
No Asbestos						
<b>B00F - R0028 - Change (3.06 m2)</b>						
No Asbestos						
<b>B00F - R0029 - Cleaning Store - Distributed (3.13 m2)</b>						
No Asbestos						
<b>B00F - R0030 - Food Technology L.S. (56.4 m2)</b>						
No Asbestos						
<b>B00F - R0031 - Computer Room (31.81 m2)</b>						
No Asbestos						
<b>B00F - R0032 - Staff Study (10.53 m2)</b>						
No Asbestos						
<b>B00F - R0033 - Covered Area (95.8 m2)</b>						
No Asbestos						
<b>B00F - R1001 - Art Learning Space (66.27 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00F/R1001/Ceiling Structures/Linings/S7					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8480/B00F/R1001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
<b>B00F - R1002 - Music Learning Space (66.14 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00F/R1001/Ceiling Structures/Linings/S7					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R1003 - Music Learning Space (65.84 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00F/R1001/Ceiling Structures/Linings/S7					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R1004 - Resources (17.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00F/R1001/Ceiling Structures/Linings/S7					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8480/B00D/R0008/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
<b>B00F - R1005 - Practice/Seminar (14.69 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00F/R1001/Ceiling Structures/Linings/S7					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00F - R1006 - Design L.S. (65.71 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00F/R1001/Ceiling Structures/Linings/S7					Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R1007 - General Storeroom (7.47 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00F/R1001/Ceiling Structures/Linings/S7					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00F - R1008 - Design L.S. (66.03 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00F/R1001/Ceiling Structures/Linings/S7					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
<b>B00F - R1009 - General Storeroom (6.37 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00F/R1001/Ceiling Structures/Linings/S7					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8480/B00D/R0008/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
<b>B00F - R1010 - Distribution Board Cupboard (0.54 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00F - R1011 - Movement (53.94 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00F/R1001/Ceiling Structures/Linings/S7					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8480/B00D/R0008/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
<b>B00F - R1012 - Art Learning Space (65.29 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00F/R1001/Ceiling Structures/Linings/S7					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8480/B00F/R1001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)
<b>B00F - R1013 - Resources Store (19.8 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8480/B00F/R1013/Floor Coverings Res/Textile/S9					No Asbestos Detected
<b>B00F - R1014 - External Movement (28.75 m2)</b>						
No Asbestos						
<b>B00F - R1015 - Stairs (3.49 m2)</b>						
No Asbestos						
<b>B00F - R1016 - Stairs (17.83 m2)</b>						
No Asbestos						
<b>B00F - R2003 - General Storeroom (7.53 m2)</b>						
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8480/B00F/R2001/Wall Linings Internal/S10					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8480/B00F/R2001/Wall Linings Internal/S10					Chrysotile (white asbestos)
<b>B00F - R2004 - External Movement (28.75 m2)</b>						
No Asbestos						
<b>B00F - R2005 - Stairs (17.83 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8480/B00F/R0021/Ceiling Structures/Linings/S31					Limited Samples Taken
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - R2006 - Science Laboratory (17.48 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Science - 1972 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible
Underfloor Voids	Non Accessible Area - Area inaccessible

**Interior****B00G - R0001 - General Learning Space - S/P (91.49 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00G - R0002 - Laboratory L.S. (92.37 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00G/R1001/Floor Coverings Res/Textile/S5						Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00G - R0006 - Laboratory L.S. (91.8 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00G/R1001/Floor Coverings Res/Textile/S5						Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00G - R0007 - General Learning Space - S/P (91.68 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00G - R0012 - Distribution Board Cupboard (0.6 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00G - R0015 - Toilets-Disabled (7.83 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1015/Ceiling Structures/Linings/S23					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00G - R0016 - Laundry (7.65 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1015/Ceiling Structures/Linings/S23					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00G - R0017 - Movement (6.1 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1015/Ceiling Structures/Linings/S23					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00G - R0018 - Staff Kitchen (23.78 m2)**

Ceiling Structures/Linings	Vermiculite 8480/B00G/R1015/Ceiling Structures/Linings/S23					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00G - R0019 - Movement (58.49 m2)**

No Asbestos

**B00G - R0020 - Movement (60.25 m2)**

No Asbestos

**B00G - R0021 - External Movement (62.66 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
<b>B00G - R0022 - Preparation - Science (44.84 m2)</b>						
No Asbestos						
<b>B00G - R1001 - Laboratory L.S. (91.52 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00G/R1001/Floor Coverings Res/Textile/S5				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					
8480/B00G/R1001/Ceiling Structures/Linings/S6				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00G - R1002 - Staff Room (91.61 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00G/R1001/Floor Coverings Res/Textile/S5				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					
8480/B00G/R1001/Ceiling Structures/Linings/S6				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00G - R1006 - Laboratory L.S. (91.69 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	30m2	Room perimeter	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00G/R1001/Floor Coverings Res/Textile/S5				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					
8480/B00G/R1001/Ceiling Structures/Linings/S6				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00G - R1007 - Laboratory L.S. (91.49 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00G/R1001/Floor Coverings Res/Textile/S5				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					
8480/B00G/R1001/Ceiling Structures/Linings/S6				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00G - R1008 - Preparation - Science (30.8 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00G/R1001/Floor Coverings Res/Textile/S5				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					
8480/B00G/R1001/Ceiling Structures/Linings/S6				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00G - R1009 - Preparation (12.57 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00G/R1001/Floor Coverings Res/Textile/S5				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					
8480/B00G/R1001/Ceiling Structures/Linings/S6				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00G - R1010 - Chemical Store (2.63 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00G/R1001/Floor Coverings Res/Textile/S5				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Vermiculite					
8480/B00G/R1001/Ceiling Structures/Linings/S6				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00G - R1011 - Movement (65.9 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00G/R1001/Floor Coverings Res/Textile/S5				<b>Chrysotile (white asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Vermiculite  
 8480/B00G/R1001/Ceiling Structures/Linings/S6 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00G - R1012 - Movement (57.76 m2)**

No Asbestos

**B00G - R1013 - Distribution Board Cupboard (0.61 m2)** Note: No inspection of live electrical installation.

No Asbestos

**B00G - R1014 - External Movement (56.52 m2)**

No Asbestos

**B00G - R1015 - Staff Study (46.61 m2)**

Ceiling Structures/Linings Vermiculite  
 8480/B00G/R1015/Ceiling Structures/Linings/S23 **Limited Samples Taken**  
*Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works*

**B00G - R9001 - Secure Storeroom (25.97 m2)**

No Asbestos

**B00G - R9002 - Garden Store Room (16.3 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00H - General Learning/Library - 1972 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Underfloor Voids	Non Accessible Area - Area inaccessible					
Ceiling Voids	Non Accessible Area - Area inaccessible					
<b>Interior</b>						
<b>B00H - R0001 - Workroom (31.08 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R0004 - General Storeroom (15.85 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 8480/B00H/R0003/Partition Walls (Cubicles)/S13	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B00H - R0005 - Cleaning Store - Distributed (5.03 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R0006 - General Storeroom (7.91 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R0007 - General Storeroom (7.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R0008 - General Storeroom (7.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R0012 - Interview/Office - Type 1 (12.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R0013 - Careers Advisers Office (12.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R0017 - Distribution Board Cupboard (0.69 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00H - R0019 - Stairs (9.94 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00H/R0019/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R0020 - General Storeroom (3.69 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8480/B00H/R0020/Floor Coverings Res/Textile/S26	3.69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Adhesive	3.69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00H/R0020/Floor Coverings Res/Textile/S27				<b>Chrysotile (white asbestos)</b>		
<b>B00H - R0021 - Stairs (6.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00H/R0019/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00H - R0022 - External Movement (31.13 m2)</b>						
No Asbestos						
<b>B00H - R0023 - Kiln Space (7.25 m2)</b>						
Kiln	Encapsulated Insulation material within unit					
8480/B00H/R0023/Kiln/S28				<b>No Asbestos Detected</b>		
Kiln	Refractory Brick					
8480/B00H/R0023/Kiln/S29				<b>No Asbestos Detected</b>		
<b>B00H - R0026 - General Learning Space (52.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00H/R0019/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00H - R0027 - Senior Study (25.81 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00H/R0019/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00H - R0028 - Movement (9.15 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00H/R0019/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Floor Coverings Res/Textile	Adhesive	9.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00H/R0020/Floor Coverings Res/Textile/S27				<b>Chrysotile (white asbestos)</b>		
Floor Coverings Res/Textile	Vinyl Tiles	9.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00H/R0020/Floor Coverings Res/Textile/S26				<b>Chrysotile (white asbestos)</b>		
<b>B00H - R0029 - Library Administration (276.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00H/R0019/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00H - R0030 - Librarian (25.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00H/R0019/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00H - R0031 - Movement (47.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00H/R0019/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
<b>B00H - R0032 - Garden Store Room (1.4 m2)</b>						
No Asbestos						
<b>B00H - R0033 - Movement (10.47 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
8480/B00H/R0019/Ceiling Structures/Linings/S25				<b>Limited Samples Taken</b>		
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8480/B00H/R0033/Partition Walls (Cubicles)/S30				<b>Chrysotile (white asbestos)</b>		
<b>B00H - R0034 - Staff Room (5.07 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8480/B00H/R0019/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R1001 - Duplicating Workroom (25.26 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R1002 - Movement (34.17 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8480/B00D/R0008/Floor Coverings Res/Textile/S3	35m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B00H - R1003 - General Learning Space (38.62 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R1004 - Staff Study (16.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R1005 - Distribution Board Cupboard (0.8 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
No Asbestos						
<b>B00H - R1006 - Computer Learning Space (40.97 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R1007 - Movement (21.78 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8480/B00D/R0008/Floor Coverings Res/Textile/S3	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B00H - R1008 - General Learning Space (40.87 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R1009 - Movement (20.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8480/B00D/R0008/Floor Coverings Res/Textile/S3	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B00H - R1010 - General Learning Space (52.2 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R1011 - General Learning Space (52.64 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R1012 - Staff Study (18.6 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R1013 - General Learning Space (66.58 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R1014 - General Learning Space (52.64 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R1015 - General Learning Space (53.22 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R1016 - General Storeroom (6.11 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8480/B00D/R0008/Floor Coverings Res/Textile/S3	7m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B00H - R1017 - Cleaning Store - Distributed (5.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00G/R1001/Ceiling Structures/Linings/S6					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R1018 - External Movement (39.64 m2)</b>						
No Asbestos						
<b>B00H - R1019 - Stairs (7.74 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00H/R0019/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R1020 - Stairs (5.92 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00H/R0019/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R9001 - General Storeroom (27.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00H/R0019/Ceiling Structures/Linings/S25					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00H - R9002 - Stairs (12.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8480/B00H/R9002/Ceiling Structures/Linings/S33					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Physical Education - 2010 - Concrete (Concrete)**

**Exterior**

No Asbestos

**Interior**

**B00I - R0001 - Gymnasium (1450.06 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Building Services - 2010 - Brick Shed (Brick Shed)**

**Exterior**

No Asbestos

**Interior**

**B00J - R0001 - Sport Equipment Store (15.62 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Other - 2012 - Brick/Steel Frame (Brick/Steel Frame)**

**Exterior**

No Asbestos

**Interior**

**B00K - R0001 - Covered Area (143.49 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Art - 2012 - Brick/Block (Brick/Block)**

**Exterior**

No Asbestos

**Interior**

**B00L - R0001 - Kiln Space (25.23 m2)**

No Asbestos

**B00L - R0002 - Art Outdoor Area (18.4 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Agricultural Science - 1994 - Steel (Steel)**

**Exterior**

No Asbestos

**Interior**

**B00M - R0002 - Workshop Area (52.19 m2)**

No Asbestos

**B00M - R0003 - Shed Workshop (46.76 m2)**

No Asbestos

**B00M - R0004 - Garden Store Room (46.41 m2)**

No Asbestos

**B00M - R0005 - Garden Store Room (0.88 m2)**

No Asbestos

**B00M - R0006 - Garden Store Room (0.92 m2)**

No Asbestos

**B00M - R0007 - Garden Store Room (0.92 m2)**

No Asbestos

**B00M - R0008 - Garden Store Room (0.96 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017