


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Hobartville Public School (4452)
Region : Western Sydney
State Electorate : Hawkesbury
Local Government Area : Hawkesbury

Initial Survey : Noel Arnold & Associates : 13 - May - 2008
Reviewed By : Parsons Brinckerhoff : 07 - Feb - 2017

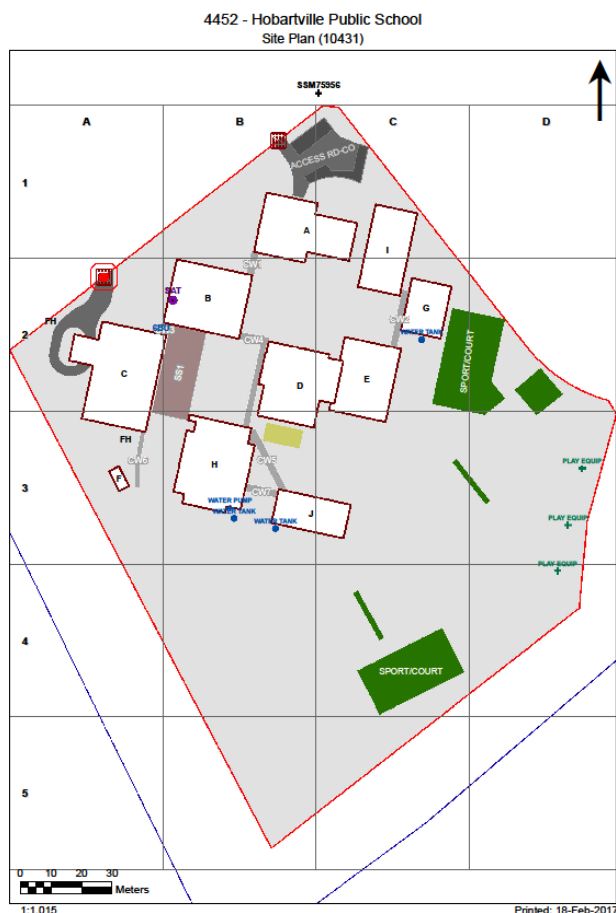

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No		Test Result				
B00A - Pupil Facilities/Building Services - 1971 - Brick/Block (Brick/Block)						
Exterior						
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Interior						
B00A - R0001 - Movement						
No Asbestos						
B00A - R0002 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4452/B00A/R0004/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00A - R0003 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4452/B00A/R0004/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00A - R0004 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4452/B00A/R0004/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00A - R0005 - Sports Store						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4452/B00A/R0004/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00A - R0006 - Staff Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4452/B00A/R0004/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00A - R0007 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4452/B00A/R0008/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00A - R0008 - Canteen						
Floor Coverings Res/Textile	Vinyl Tiles	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4452/B00A/R0008/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00A - R0009 - Canteen Office/Store						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4452/B00A/R0004/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4452/B00A/R0008/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00A - R0010 - Garden Store						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4452/B00A/R0004/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00A - R0011 - Craft Store						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4452/B00A/R0004/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00A - R0012 - General Assistant/Bulk Store						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4452/B00A/R0004/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00A - R0013 - Toilets - Boys						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4452/B00A/R0004/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
4452/B00A/R0013/Partition Walls (Cubicles)/S4				Chrysotile (white asbestos)		

B00A - R0014 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
B00B - Administration/Staff Facilities - 1971 - Brick/Block (Brick/Block)						
Exterior						
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Interior						
B00B - R0001 - Principal						
No Asbestos						
B00B - R0002 - Staff Toilet						
No Asbestos						
B00B - R0003 - General Storeroom						
No Asbestos						
B00B - R0004 - Staff Toilet						
No Asbestos						
B00B - R0005 - Staff Toilet						
No Asbestos						
B00B - R0006 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00B/R0008/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	
B00B - R0007 - Staff Room						
No Asbestos						
B00B - R0008 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00B/R0008/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	
B00B - R0009 - Cleaning Supplies						
No Asbestos						
B00B - R0010 - General Storeroom						
No Asbestos						
B00B - R0011 - Community Clinic						
No Asbestos						
B00B - R0012 - Community Clinic						
No Asbestos						
B00B - R0013 - Community Clinic						
No Asbestos						
B00B - R0014 - Staff Room Annexe						
No Asbestos						
B00B - R0015 - Staff Toilet						
No Asbestos						
B00B - R0016 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00B/R0008/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	
B00B - R0017 - Clerical Office						
No Asbestos						
B00B - R0018 - Movement						
No Asbestos						
B00B - R0019 - Cleaning Distributed Store						
No Asbestos						
B00B - R0020 - Sick Bay						
No Asbestos						
B00B - R0021 - Distribution Board				Note: No inspection of live electrical installation.		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00B/R0008/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00B/R0021/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	4m2	On inside panel of door	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00B/R0021/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0022 - Entry Vestibule

No Asbestos

B00B - R0023 - Deputy Principal

No Asbestos

B00B - R0024 - Movement

No Asbestos

B00B - R0025 - Duplicating Workroom

No Asbestos

B00B - R0026 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
B00C - General Learning/Pupil Facilities - 1971 - Brick/Block (Brick/Block)						
Exterior						
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Interior						
B00C - R0001 - Movement						
No Asbestos						
B00C - R0002 - Toilets - Boys						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0003/Partition Walls (Cubicles)/S14				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0003/Ceiling Structures/Linings/S15				Chrysotile (white asbestos)	
B00C - R0003 - Toilets - Girls						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0003/Partition Walls (Cubicles)/S14				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0003/Ceiling Structures/Linings/S15				Chrysotile (white asbestos)	
B00C - R0004 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0003/Ceiling Structures/Linings/S15				Chrysotile (white asbestos)	
B00C - R0005 - Cleaning Supplies						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0003/Ceiling Structures/Linings/S15				Chrysotile (white asbestos)	
Kiln (woodrow)	Encapsulated Insulation material within unit 4452/B00C/R0005/Kiln (woodrow)/S18				No Asbestos Detected	
B00C - R0006 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0006/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)	
B00C - R0007 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles	60m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0006/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)	
B00C - R0008 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0006/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0003/Ceiling Structures/Linings/S15				Chrysotile (white asbestos)	
B00C - R0009 - Toilets - Boys/Girls						
No Asbestos						
B00C - R0010 - Toilets - Boys/Girls						
No Asbestos						
B00C - R0011 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0006/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0003/Ceiling Structures/Linings/S15				Chrysotile (white asbestos)	
B00C - R0012 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles	60m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0006/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)	
B00C - R0013 - Personal Effects Storage						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0006/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)	
B00C - R0014 - Distribution Board				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0006/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	4m2	Inside of door	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0014/Wall Linings Internal/S17				Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R0015 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0006/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)	
B00C - R0016 - Home Base Store						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0006/Floor Coverings Res/Textile/S16				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0003/Ceiling Structures/Linings/S15				Chrysotile (white asbestos)	
B00C - R0017 - Toilets - Boys/Girls						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00C/R0003/Ceiling Structures/Linings/S15				Chrysotile (white asbestos)	
B00C - R0018 - Covered Vehicle Area/Porte Cochere						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - General Learning - 1971 - Brick/Block (Brick/Block)						
Exterior						
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Interior						
B00D - R0001 - Movement						
No Asbestos						
B00D - R0004 - P.E. Store						
No Asbestos						
B00D - R0005 - Movement						
Ceiling Structures/Linings	Vermiculite	No Asbestos Detected				
	4452/B00D/R0010/Ceiling Structures/Linings/S9					
B00D - R0006 - Staff Toilet						
Ceiling Structures/Linings	Vermiculite	No Asbestos Detected				
	4452/B00D/R0010/Ceiling Structures/Linings/S9					
B00D - R0007 - Toilets - Boys						
Ceiling Structures/Linings	Vermiculite	No Asbestos Detected				
	4452/B00D/R0010/Ceiling Structures/Linings/S9					
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00D/R0010/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)
B00D - R0009 - Cleaning Distributed Store						
No Asbestos						
B00D - R0013 - Withdrawal Space - 1hb						
No Asbestos						
B00D - R0014 - Distribution Board						
Wall Linings Internal	Flat AC Sheeting	6m2	Inside of door	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00D/R0014/Wall Linings Internal/S6					Chrysotile (white asbestos)
B00D - R0015 - Movement						
Ceiling Structures/Linings	Vermiculite	No Asbestos Detected				
	4452/B00D/R0010/Ceiling Structures/Linings/S9					
B00D - R0016 - Movement						
Ceiling Structures/Linings	Vermiculite	No Asbestos Detected				
	4452/B00D/R0010/Ceiling Structures/Linings/S9					
B00D - R0017 - General Storeroom						
No Asbestos						
B00D - R0018 - Home Base - M						
Ceiling Structures/Linings	Vermiculite	No Asbestos Detected				
	4452/B00D/R0010/Ceiling Structures/Linings/S9					
B00D - R0019 - Home Base - M						
Ceiling Structures/Linings	Vermiculite	No Asbestos Detected				
	4452/B00D/R0010/Ceiling Structures/Linings/S9					
B00D - R0020 - Movement						
Wall Linings Internal	Flat AC Sheeting	No Asbestos Detected				
	4452/B00D/R0020/Wall Linings Internal/S8					
B00D - R0021 - Stairs						
No Asbestos						
B00D - R0022 - Stairs						
No Asbestos						
B00D - R0024 - Toilets - Girls						
Ceiling Structures/Linings	Vermiculite	No Asbestos Detected				
	4452/B00D/R0010/Ceiling Structures/Linings/S9					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
B00D - R0025 - Access Shower/Toilet/Change						
No Asbestos						
B00D - R0026 - Toilets - Boys						
No Asbestos						
B00D - R0027 - Special Programs Room						
No Asbestos						
B00D - R0028 - General Storeroom						
No Asbestos						
B00D - R0029 - Movement						
No Asbestos						
B00D - R1001 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles					
	4452/B00D/R1001/Floor Coverings Res/Textile/S10					No Asbestos Detected
B00D - R1002 - Movement						
No Asbestos						
B00D - R1003 - Home Base						
Ceiling Structures/Linings	Vermiculite					
	4452/B00D/R0010/Ceiling Structures/Linings/S9					No Asbestos Detected
B00D - R1004 - Communications Room						
Ceiling Structures/Linings	Vermiculite					
	4452/B00D/R0010/Ceiling Structures/Linings/S9					No Asbestos Detected
B00D - R1005 - Movement						
No Asbestos						
B00D - R1012 - Stairs						
No Asbestos						
B00D - R1013 - Stairs						
No Asbestos						
B00D - R1014 - Withdrawal Space - 2hb						
No Asbestos						
B00D - R1015 - Home Base Store						
No Asbestos						
B00D - R1016 - Home Base Store						
No Asbestos						
B00D - R1017 - Home Base						
No Asbestos						
B00D - R1018 - Home Base						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	
B00E - General Learning/Building Services - 1971 - Brick/Block (Brick/Block)						
Exterior						
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Interior						
B00E - R0001 - Movement						
No Asbestos						
B00E - R0002 - Home Base						
Ceiling Structures/Linings	Vermiculite					No Asbestos Detected
	4452/B00E/R1005/Ceiling Structures/Linings/S11					
B00E - R0003 - Cleaning Distributed Store						
Wall Linings Internal	Flat AC Sheeting	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00E/R1002/Wall Linings Internal/S12					
	Chrysotile (white asbestos)					
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00E/R1002/Wall Linings Internal/S12					
	Chrysotile (white asbestos)					
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00E/R0008/Floor Coverings Res/Textile/S13					
	Chrysotile (white asbestos)					
B00E - R0004 - Distribution Board						
Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting	8m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00E/R1002/Wall Linings Internal/S12					
	Chrysotile (white asbestos)					
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00E/R1002/Wall Linings Internal/S12					
	Chrysotile (white asbestos)					
B00E - R0005 - Staff Room Annexe						
Ceiling Structures/Linings	Vermiculite					No Asbestos Detected
	4452/B00E/R1005/Ceiling Structures/Linings/S11					
B00E - R0006 - Home Base						
Ceiling Structures/Linings	Vermiculite					No Asbestos Detected
	4452/B00E/R1005/Ceiling Structures/Linings/S11					
B00E - R0007 - Home Base						
Ceiling Structures/Linings	Vermiculite					No Asbestos Detected
	4452/B00E/R1005/Ceiling Structures/Linings/S11					
B00E - R0008 - Movement						
Ceiling Structures/Linings	Vermiculite					No Asbestos Detected
	4452/B00E/R1005/Ceiling Structures/Linings/S11					
Floor Coverings Res/Textile	Vinyl Tiles	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00E/R0008/Floor Coverings Res/Textile/S13					
	Chrysotile (white asbestos)					
B00E - R0009 - Home Base						
Ceiling Structures/Linings	Vermiculite					No Asbestos Detected
	4452/B00E/R1005/Ceiling Structures/Linings/S11					
B00E - R1001 - Home Base						
Ceiling Structures/Linings	Vermiculite					No Asbestos Detected
	4452/B00E/R1005/Ceiling Structures/Linings/S11					
B00E - R1002 - Cleaning Distributed Store						
Wall Linings Internal	Flat AC Sheeting	3m2	Inside of door	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00E/R1002/Wall Linings Internal/S12					
	Chrysotile (white asbestos)					
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4452/B00E/R1002/Wall Linings Internal/S12					
	Chrysotile (white asbestos)					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R1003 - Withdrawal Space - 1hb						
Ceiling Structures/Linings	Vermiculite					
	4452/B00E/R1005/Ceiling Structures/Linings/S11					No Asbestos Detected
B00E - R1004 - Home Base						
Ceiling Structures/Linings	Vermiculite					
	4452/B00E/R1005/Ceiling Structures/Linings/S11					No Asbestos Detected
B00E - R1005 - Home Base						
Ceiling Structures/Linings	Vermiculite					
	4452/B00E/R1005/Ceiling Structures/Linings/S11					No Asbestos Detected
B00E - R1006 - Movement						
Ceiling Structures/Linings	Vermiculite					
	4452/B00E/R1005/Ceiling Structures/Linings/S11					No Asbestos Detected
B00E - R1007 - Home Base						
Ceiling Structures/Linings	Vermiculite					
	4452/B00E/R1005/Ceiling Structures/Linings/S11					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00F - Building Services - 1971 - Brick/Veneer (Brick/Veneer)**Exterior**

Eaves Linings	Flat AC Sheeting 4452/B00F/Eaves Linings/S19	No Asbestos Detected				
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior**B00F - R0001 - General Assistant/Bulk Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00G - General Learning - 2004 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00G - R0001 - Movement**

No Asbestos

B00G - R0002 - Practical Activities - 1hb

No Asbestos

B00G - R0003 - Home Base Store

Vinyl Tiles (Under Floor No Asbestos Found
Covering/Carpet)

B00G - R0004 - Home Base

Vinyl Tiles (Under Floor No Asbestos Found
Covering/Carpet)

B00G - R0005 - Withdrawal Space - 2hb

Vinyl Tiles (Under Floor No Asbestos Found
Covering/Carpet)

B00G - R0006 - Home Base

Vinyl Tiles (Under Floor No Asbestos Found
Covering/Carpet)

B00G - R0007 - Home Base Store

Vinyl Tiles (Under Floor No Asbestos Found
Covering/Carpet)

B00G - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00H - Communal Facilities - 2007 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00H - R0001 - Communal Space**

No Asbestos

B00H - R0002 - Access Shower/Toilet

No Asbestos

B00H - R0003 - Toilets - Boys

No Asbestos

B00H - R0004 - Sound Cupboard

No Asbestos

B00H - R0005 - General Assistant/Bulk Store

No Asbestos

B00H - R0006 - Garden Store

No Asbestos

B00H - R0007 - Movement

No Asbestos

B00H - R0008 - Hall Chair Store

No Asbestos

B00H - R0009 - Cleaning Supplies

No Asbestos

B00H - R0010 - Ramp

No Asbestos

B00H - R0011 - Raised Platform

No Asbestos

B00H - R0012 - Communal/Performance Store

No Asbestos

B00H - R0013 - Main Switch Board

No Asbestos

B00H - R0014 - Cleaning Distributed Store

No Asbestos

B00H - R0015 - Seminar/Study

No Asbestos

B00H - R0016 - Communal/Performance Store

No Asbestos

B00H - R0017 - Toilets - Girls

No Asbestos

B00H - R0018 - External Movement

No Asbestos

B00H - R0019 - External Movement

No Asbestos

B00H - R0020 - Movement

No Asbestos

B00H - R0021 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00I - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00I - R0001 - Home Base**

No Asbestos

B00I - R0002 - Practical Activities - 1hb

No Asbestos

B00I - R0003 - Home Base Store

No Asbestos

B00I - R0004 - Withdrawal Space - 1hb

No Asbestos

B00I - R0005 - Home Base

No Asbestos

B00I - R0006 - Home Base Store

No Asbestos

B00I - R0007 - Practical Activities - 1hb

No Asbestos

B00I - R0008 - Withdrawal Space - 2hb

No Asbestos

B00I - R0009 - Home Base

No Asbestos

B00I - R0010 - Home Base Store

No Asbestos

B00I - R0011 - Practical Activities - 1hb

No Asbestos

B00I - R0012 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No	Test Result				

B00J - Library - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00J - R0001 - Reading Area**

No Asbestos

B00J - R0002 - Library Office/Workroom

No Asbestos

B00J - R0003 - Communications Room

No Asbestos

B00J - R0004 - K.L.A. Store

No Asbestos

B00J - R0005 - Toilet - Lobby

No Asbestos

B00J - R0006 - Staff Toilet

No Asbestos

B00J - R0007 - Cleaning Distributed Store

No Asbestos

B00J - R0008 - Main Switch Board

No Asbestos

B00J - R0009 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables
There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017